CERTIFIED LAND CORNER RECORDATION

ACCESSORY CORNERS IN SEC. 4 TWP. 31 N., R. 33 W., M.P.M.

DESCRIPTION OF CORNER EVIDENCE FOUND, AND ORIGINAL RECORD (IF KNOWN)

North 1/4 Corner, South 1/4 Corner, and Northeast Corner of Section 4 - Brass Caps set by B.L.M.

B.L.M. reported re east 1/4 Corner "Searched for but not found.".

We made further unsuccessful search.

DESCRIPTION OF MONUMENT AND ACCESSORIES ESTABLISHED TO PERPETUATE THE ORIGINAL LOCATION OF THIS CORNER:

Date of work: 0ct.15,1970

SEE OTHER SIDE

SKETCH, WITH COURSE AND DISTANCE TO ADJACENT CORNERS IF DETERMINED IN THIS SURVEY. (MAY SKETCH OR PASTE REPRODUCTION ON REVERSE SIDE.)

SEE OTHER SIDE


		L		
			DIAGRAM O	F CORNER:
Surveyor's Seal	I. Jack H. Ninnema	n		
	certify that the information shown herein is true and correct.		N. Corners	in
			, Sec. 4	See
	Signature of Ground Party Chief		Other s	ide
	Jack W. Ninneman		_	
	certify that I have carefully performed or reviewed the work done on the diagrammed corner as reported on this recordation form and approve the same.		•	•
	Jack W. Du. Signatu	nnlma	= Corner recorded	l on the sheet
	V	Montana License No.	534 E.S.	
	•	Registration Number	,	
Office of Clerk and Recorder,	County of Lincoln			· g)
This "corner record" was filed	for record on the the day of	February 19 71, was	noted on the cross-i	index plat and is
essioned name No. 211	, in book No1	ELEANOR L. VAUG	HN, By:	
assigned page 110	and the same and t	Coun	ity Official	Deputy

Cross Index No. A. 11, 12, 13 T. 31 R.

2-11,12,13 - 32-33.

B 11,12 C·13

Section 16 Twp. 31 N., R. 33W, M.P.M.

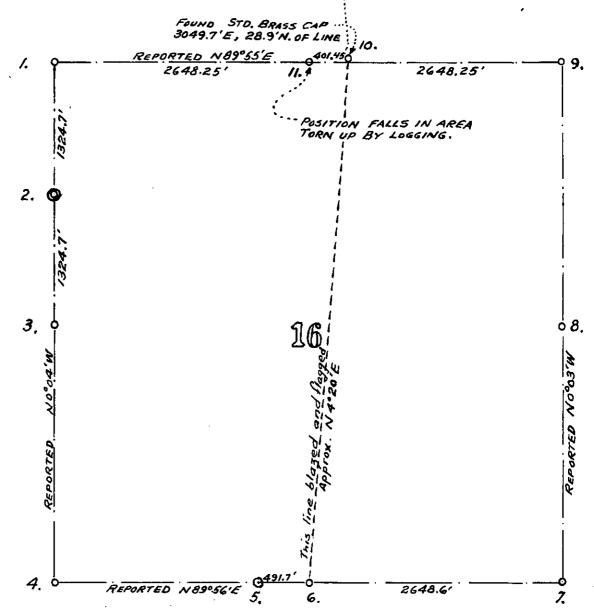

- 1. Standard brass cap with witnesses.
- 2. Set a 3/4" Pipe 18" long in a stone mound (on line at mid-point between NW Corner and position accepted as location of West $\frac{1}{4}$ Corner) from which a 24" larch bears S 37° Scribed 1/16 and posted with bearing tree location sign.
- 3. Corner not found but position confirmed by measurement and by illegible remains of bearing trees in reported locations.
- 4. Standard brass cap.
- 5. Stump of one bearing tree found. Corner not reset.
- 6. Bearing tree remains found and part of original post in position. = See below.
- 7. Standard brass cap.
- 8. Not searched for.
- 9. One bearing tree live, standing. One bearing tree down, legible but slid down hill from original position. We set a steel rod at position reported from live bearing tree. 10. FOUND STANDARD BRASS CAP. ADJUSTED TRANSIT TRAVERSE OF NORTH LINE OF SUBJECT SECTION
- POSITIONS THIS MONUMENT 401.45 FEET EAST AND 28.9 FEET NORTH OF MID-POINT BETWEEN CORNERS.
- 11. Corner not found Position falls in area torn up by logging operations. No bearing trees reported for original corner.
 - * Set a squared cedar post, marked $\frac{1}{4}$ on east face from which, An 18" Fir bears S 1 E 18 feet. An 18" Fir bears S 1 $^{\circ}$ E 18 feet. A 12% Fir bears N $2\frac{1}{2}$ E $3\frac{1}{2}$ feet. Both marked $\frac{1}{4}$.