
## CERTIFIED CORNER RECORDATION

										<del></del>
Corner	N 1/16	Sec.	25&26	T.	36N	R.	27W	P.M., MT	Lincoln	County

- I. 1993 Certificate of Survey No. 2028 by Dawn Marquardt Registration No. 7328 S: Set a 5/8 in. x 24 in. rebar with a plastic cap, stamped "7328 S".
- II. Found a 5/8 in. diam. rebar, firmly set, protruding 2 ins. above the ground, with a yellow plastic cap, stamped "Marquardt 2989 ES". No bearing trees found. Certificate of Survey No. 2028, shows set rebar, with plastic cap stamped "7328 S".
- III. Accepted the found position of the Marquardt rebar and set a 3/4 in. diam. x 30 ins. long aluminum rod, at the found rebar position, 27 ins. in the ground, with a 3 1/4 in. diam. aluminum cap, mkd. as shown:

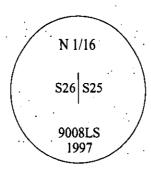


from which:

A fir, 8 ins. diam., bears N52°E, 30.9 ft. dist., mkd. "N 1/16 S25 BT". A fir, 5 ins. diam., bears N55°W, 22.5 ft. dist., mkd. "N 1/16 S26 BT". A 6 ft. steel post, bears South, on property line, 3.0 ft. dist. from the corner.

Painted bearing trees and attached Land Survey Monument and Bearing Tree signs. Attached Land Survey Monument and Property Boundary decals to the post.

A location poster, bears N45°E, approx. 125 ft. dist. from the corner, located near the beginning of the Frank Lake Road.

Magnetic Declination: 20° East.

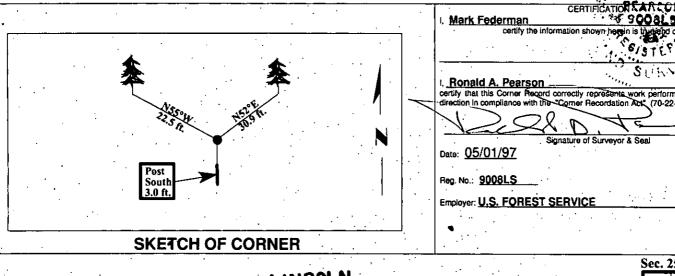



Cross Index No.

S-21

36N

P.M., MT