

1. Original and/or subsequent record used to evaluate the corner position.
2. Description of evidence found, note discrepancies in the record, state method of establishing lost or obliterated corners.
3. Description of monument and accessories set to perpetuate the corner position.
4. Sketch of corner, show all pertinent data which can best be shown in a sketch example, corner marking, topography ties, position of accessories,
5. Certification must be signed and sealed by Land Surveyor registered in the State of Montana.

**CERTIFIED CORNER RECORDATION**Corner: 1/4 Corner, Sections 14, 15T. 26N.R. 29W. P.M.M. Lincoln County

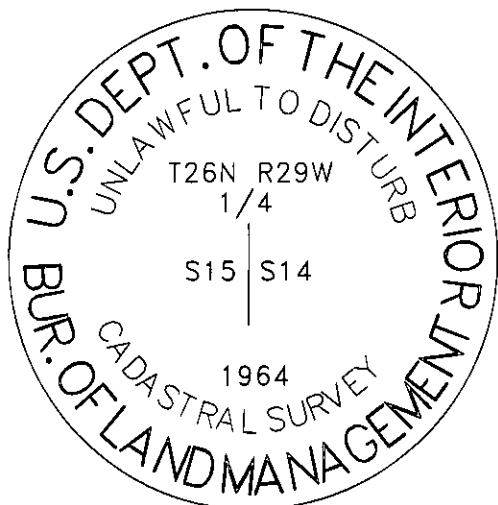
1903 GLO Record: Set limestone. Established 2 BTs.

1964 BLM Record: Found the remains of the 2 BTs.  
An 11" fir, bears N51 1/4°E, 39 lks (25.7 ft.), with an overgrown blaze, (GLO Record)  
A stumphole, bears N72 1/4°W, 16 lks (10.6 ft.), remains of tree lying on ground with  
burned out blaze, (GLO Record)  
At the corner point, set iron post, 30" long, 2 1/2" dia., 27" in the ground, with brass cap.  
Established 1 new bearing tree  
A 16" fir, bears N35°W, 66 lks (43.6 ft.), marked 1/4 S15 BT

1972 Record: Found 2 1/2" iron pipe lying on the ground, displaced by logging operations  
(Maude) A 11" d. fir, bears N51 1/4°E, 39 lks (25.7 ft.)  
A 16" d. fir, bears N35°W, 66 lks, (43.6 ft.)  
Proper position of corner is found by reference to the 2 existing bearing trees.  
Reset 2 1/2"x27" iron pipe & mon. used in 1964 remonumentation.  
New bearing tree:  
A 10" p. pine, bears S10°E, 45 lks (29.7 ft.), marked RM

2009 Found: We find a standard. BLM monument. with a 3 1/4" brass cap, 10" above the ground, in a logging  
skid trail. The cap was stamped as shown below, from which:  
A 14" Douglas fir, bears N51°E, 25.7 ft., with overgrown blaze & BT tag  
A 22" Douglas fir, bears N35°W, 43.6 ft., with overgrown blaze & BT tag  
A 14" stump, bears S07°E, 29.7 ft., with no visible scribing

2009 Perpetuation: We set a galvanized steel post with USFS decals P54+1 & P71-10, 0.4 ft., south of the  
monument.  
We paint red bands on the new bearing trees, and attached USFS signs 54-3 & 54-9.

SEE COS NO. 3990**SKETCH OF CORNER**

CERTIFICATION  
I, Chad R. Breuer  
certify the information shown herein is true and  
correct.

Signature Ground Party Chief

I, Ken E Jenkins  
certify that this Corner Record correctly  
represents work performed by Montana Northwest Company in  
direction in compliance with the "Corner  
Recordation Act" (70-22-101, et seq., M.C.A.)

Signature of Surveyor &amp; Seal

Date: 9/2009 Reg. No. 9330 LSEmployer: Montana Northwest CompanyPO Box 8777, Missoula, MT 59807406-721-4033 Project No. 1617-09

Office of Clerk and Recorder, County of \_\_\_\_\_, This "corner

record" was filed for record on

224842 BOOK: CCR CC&amp;R'S PAGE: 11468 Pages: 1

was noted on the cross-index

STATE OF MONTANA LINCOLN COUNTY

book No. \_\_\_\_\_

RECORDED: 03/05/2010 9:10 KOI: CC&amp;R'S

TAMMY D. LAUER CLERK AND RECORDER

FEE: \$0.00

BY: Ken E Jenkins  
TO: MONTANA NORTHWEST COMPANY P.O. BOX 8777, MISSOULA, MONTANA

Cross Index No.

L-17 T. 26N R. 29W PMM

● Corner this sheet

Sec. 14

