


INSTRUCTIONS

1. Original and/or subsequent record used to evaluate the corner position.
2. Description of evidence found, note discrepancies in the record, state method of establishing lost or obliterated corners.
3. Description of monument and accessories set to perpetuate the corner position.
4. Sketch of corner, show all pertinent data which can best be shown in a sketch example, corner marking, topography ties, position of accessories, etc.
5. Certification must be signed and sealed by Registered Land Surveyor in State of Montana.
6. Fill in Cross Index & Section Diagram at bottom of sheet.

CERTIFIED CORNER RECORDATION

Corner W $\frac{1}{2}$ S2 T. 26N R. 29W P.M.M. Lincoln County

- I. 1902 GLO Record by Adams and Weeks - set a sandstone, 14x10x5 ins, 10 ins in the ground, for $\frac{1}{4}$ sec. cor., mkd $\frac{1}{4}$ on W. face; from which:
- a pine, 24 ins diam, bears S16°30'E, 27 lks
 - a pine, 30 ins diam, bears S18°W, 46 lks
- 1964 BLM Remonumentation by Larimer and Grusing - find a sandstone 14x10x5 ins loosely set and mkd $\frac{1}{4}$ on W. face; set an iron post 30 ins long, 2 $\frac{1}{2}$ ins diam., 24 ins in the ground, and in a mound of stone, 3 ft. diam, to top, with brass cap from which:
- a stump, bears S16 $\frac{1}{2}$ °E, 21 lks with remains of tree lying on ground, visible marks (original BT)
 - a stump, bears S18°W, 46 lks with remains of tree lying on ground, visible marks (original BT)
 - a fir, 12 ins diam, bears S85°E, 43 lks (new BT)
 - a fir, 9 ins diam, bears S87°W, 44 lks (new BT)
- 1978 BLM Remonumentation by Christainsen - the $\frac{1}{4}$ sec. cor of secs. 2 and 3 as determined from the remains of the bearing trees, as described in the field notes of the 1964 remonumentation:
- a fir stump, 12 ins diam, bears S85°E, 43 lks mkd
 - a fir, 9 ins diam, bears N79°W, 44 lks, mkd (record S87°W)
- set at the corner point an iron post, 30 ins long, 2 $\frac{1}{2}$ ins diam, 24 ins in the ground, with brass cap from which a new bearing tree:
- a fir 8 ins diam, bears N3°E, 113 lks, mkd
- COS No. 1267 by Putman, 1984: fd. 2 $\frac{1}{2}$ " B.C.
- COS No. 1019 by Putman, 1982: fnd. brass cap,
- COS No. 935 by Putman, 1980: found brass cap
- COS No. 975 by Putman, 1981: fnd. brass cap
- II. Found 2 $\frac{1}{2}$ " OD pipe with 3 $\frac{1}{2}$ " brass cap, 3" up with mound of stones on west side. The corner falls on a steep SW facing slope and 75'± W. of centerline of BPA transmission line.
- III. See sketch for additional ties and accessories.

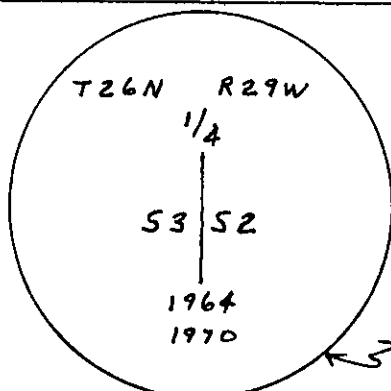

SKETCH OF CORNER

CERTIFICATION

I. Steven B. Ivey, 9329LS

certify the information shown herein is true and correct.

Steven B. Ivey
Signature Ground Party Chief

I. Dwight L. Axelsen

certify that this Corner Record correctly represents work performed by me or under my direction in compliance with the "Corner Recordation Act" (70-22-101, et seq., M.D.A.)

Dwight L. Axelsen
Signature of Surveyor & Seal


Date: Nov. 89 Reg. No. 8641LS

Employer: Delta Engineering

Office of Clerk and Recorder, County of Lincoln. This "corner record" was filed for record on the Dec 1 day of 1989 was noted on the cross-index plat and is assigned page No. 4116, in book No. _____

Janet BF Sugel by Bill Backoff
County Official

Sec. 2 W $\frac{1}{2}$

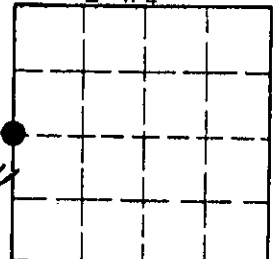

Cross Index No. _____ T. _____ R. _____ P.M.M.

• corner this sheet



No scale

