

## INSTRUCTIONS

1. Original and/or subsequent record used to evaluate the corner position.
2. Description of evidence found, note discrepancies in the record, state method of establishing lost or obliterated corners.
3. Description of monument and accessories set to perpetuate the corner position.
4. Sketch of corner, show all pertinent data which can best be shown in a sketch example, corner marking, topography ties, position of accessories, etc.
5. Certification must be signed and sealed by Land Surveyor registered in the State of Montana.
6. Fill in Cross Index & Section Diagram at bottom of sheet.

## CERTIFIED CORNER RECORDATION

Corner RM's to Cor. 1 HES 577 T. 30N R. 34W P.M.M. Lincoln County

- I. 1917 GLO Record: Set a small stone, mkd. with a cross(x), under an iron post 2ins. diam., 36ins. long, 24ins in the ground, with a brass cap mkd. 1917 CC 1 HES 577. The point top is the exact corner point. from which:

A cross(x) on a white pine 12ins. diam., bears N.75 $\frac{1}{2}$ °W., 32 lks. dist.

A Cross(x) on a cedar tree 14ins. diam., bears S.51 $\frac{1}{2}$ °W., 29 lks. dist.

Each blazed and scribed 1 HES 577 BT.

raise a mound of earth 4 ft. base and 2 ft. high, SE of corner.

1957 BLM dependant resurvey: Point for corner 1 HES 577, as determined from tie to orig. bearing tree: A pine 18ins. diam., bears N.75 $\frac{1}{2}$ °W., 32 lks. mkd. 1 HES 577 BT. The true point falls in Keeler creek, water 14ins. deep, course 8.35°E., an unsafe place for a permanent corner. No traces of the original corner remains. For the true point for corner 1 HES 577:

An iron post, 2 $\frac{1}{2}$ in. diam., 30ins. long, set 27ins. in the ground, for a reference monument, bears S.48°40'W $\frac{1}{2}$ , 75' lks. dist. the brass cap mkd. cor. 1 HES 577 RM 49.5 ft. 1957, and an arrow pointing toward corner.

An iron post, 2 $\frac{1}{2}$ in. diam., 30ins. long, set 27in. in the ground, for a reference monument, bears N.44 $\frac{1}{2}$ °W., 40.9 lks. dist. the brass cap mkd. cor. 1 HES 577 RM 27.0 ft. 1957, with an arrow pointing toward corner.




- II. No RM monuments found. Orig. position falls in Keeler Creek, the NW RM was washed out by Keeler Creek, the SW RM was taken out by logging activities. The orig. bearing tree found by BLM still stands but is split and dead.

A pine snag, 30in. diam., bears N.75 $\frac{1}{2}$ °W. from corner position, mkd. 577BT.


- III. From the true corner position, set an RM, N.45°E., 28.0 ft., a 3/4in. diam. by 30in. long aluminum rod with a 3/4in. diam. aluminum cap mkd. as shown.

From the true corner position, set an RM, S.45°W., 33.8 ft., a 3/4in. diam. by 30in. long aluminum rod with a 3/4in. diam. aluminum cap mkd. as shown. both RM's have arrows pointing toward corner.

Set 6 ft. carsonite post 2 ft. in the ground 1 ft. S. of both RM's.

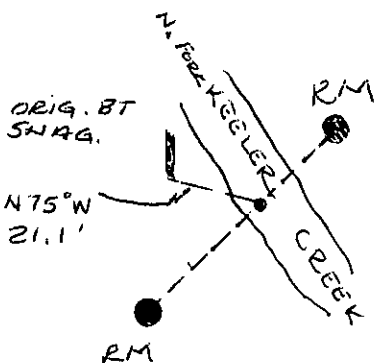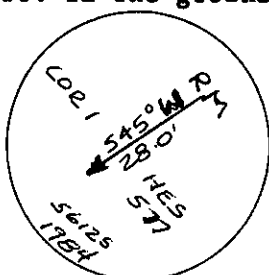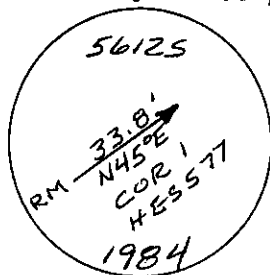

SKETCH OF CORNER

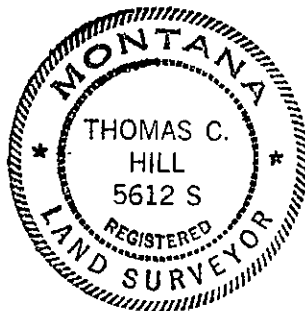

## CERTIFICATION

I, James W. Reed  
certify the information shown herein is true and correct.

James W. Reed  
Signature Ground Party Chief

I, Thomas C. Hill  
certify that this Corner Record correctly represents work performed by me or under my direction in compliance with the "Corner Recordation Act" (70-22-101, et seq., M.C.A.)

Thomas C. Hill  
Signature of Surveyor & Seal


Date: 6/21/84 Reg. No. 5612S

Employer: U.S.F.S.

Office of Clerk and Recorder, County of Lincoln. This "corner record" was filed for record on July 12, 1984 was noted on the cross-index plat and is assigned page No. 2675, in book No. \_\_\_\_\_

James B. Sigel by Jeanne Morris  
County Official Deputy

Sec. 22

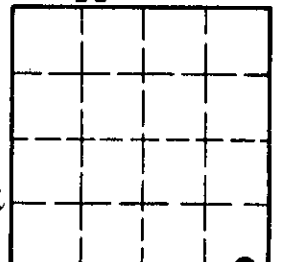

• - corner this sheet