

INSTRUCTIONS

1. Original and/or subsequent record used to evaluate the corner position.
2. Description of evidence found, note discrepancies in the record, state method of establishing lost or obliterated corners.
3. Description of monument and accessories set to perpetuate the corner position.
4. Sketch of corner, show all pertinent data which can best be shown in a sketch example, corner marking, topography ties, position of accessories, etc.
5. Certification must be signed and sealed by Land Surveyor registered in the State of Montana.
6. Fill in Cross Index & Section Diagram at bottom of sheet.

CERTIFIED CORNER RECORDATION

Corner Sec. 28, 29, 32, & 33 T. 31N R. 30W P.M.M. Lincoln County

Original GLO Notes: Set a granite stone 12x12x9 in. 8" in ground for Cor. of Sec. 28, 29, 32, & 33, mkd. w/ 1 notch on S and 4 notches on E. edges.
 From which: A tamarack 24" bears N59°10'E 95 lks., mkd. T31N R30W S28 BT.
 A Pine 7" bears S43°30'E 82 lks., mkd. T31N R30W S33 BT.
 A Pine 32" bears S6°50'W 97 lks., mkd. T31N R30W S32 BT.
 A tamarack 18" bears N70°10'W 26 lks., mkd. T31N R30W S29 BT.
 (1898 by Paul S.A. Bickel)

Corner monumentation survey: Fd. a slate stone 20x12x9 in. loosely set and mkd. $\frac{1}{4}$ on the W. face & witnessed by the remains of the original bearing trees.
 At the corner point

Set an iron post 30" long, 2 $\frac{1}{2}$ " diam., 15" in ground, to bedrock, and in a mound of stone, 4 ft. diam., to top, with brass cap mkd. T31N R30W

From which

The remains of the original bearing trees:

A stump hole bears N70 $\frac{3}{4}$ °E 59 lks., remains of tree lying on ground, visible marks $\frac{1}{4}$ S33.

A dead pine 28" bears S41°W 7 lks., visible marks $\frac{1}{4}$ S32.

The new bearing trees:

A fir 6" bears N39°E 38 lks., mkd. $\frac{1}{4}$ S33 BT.

A fir 6" bears N42°W 75 lks., mkd. $\frac{1}{4}$ S32 BT.

By:

Gerald F. Pittman,
 Cadastral Surveyor

Found a BLM 3 $\frac{1}{2}$ " brass cap on a 2" iron pipe w/corner stone alongside. 1964

Found bearing trees:

Mkd: T31N R30W

S29	S28
S32	S33

1964

A tamarack 24" N30°E 62.8 feet, scribe visible. (Original)
 A pine 20" S42°E 55.7 feet, scribe not visible. (Original)
 A pine stump (decayed) 32" record, S8°W 65.7 feet, scribe not visible. (Original)
 A fir 14" S16°W 18.7 feet, scribe not visible. (Original)
 A tamarack 24" N76°W 17.3 feet, scribe visible. (Original)
 All BT's painted and signed as per USFS Specs. and a post set near corner w/ signs attached. Built a rock cairn with stones found (not to spec.) and cleared to 6' diam.


A two track road falls 40 feet, more or less East of cor.

Decl. 20°E
 Assumed.

Cor Mkd: T31N R30W

S29	S28
S32	S33

1964

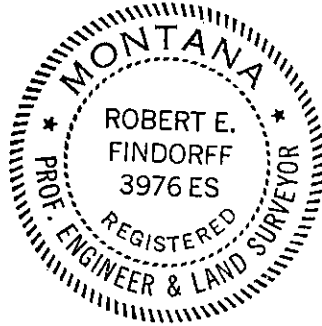

CERTIFICATION

I, Robert E. Findorff
 certify the information shown herein is true and correct.

Signature Ground Party Chief
Robert E. Findorff

I, Robert E. Findorff
 certify that this Corner Record correctly represents work performed by me or under my direction in compliance with the "Corner Recordation Act" (M.C.A. 82-101 et seq., M.C.A.)

Signature of Surveyor & Seal
Robert E. Findorff

Date: 11/11/87 Reg. No. 3976ES

Employer: Self

SKETCH OF CORNER (SEE ABOVE)


Office of Clerk and Recorder, County of Lincoln. This "corner record" was filed for record on Nov 16, 1987

was noted on the cross-index plat and is assigned page No. 3696, in

book No. _____

Grant B. Siegel by Bill Busch
 County Official Deputy

Sec. 33, T31N, R30W

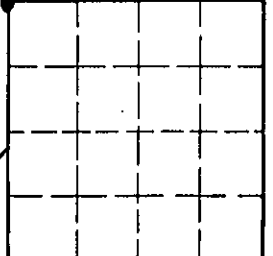

Cross Index No. V-9 T. 31N R. 30W P.M.M.

Adopted July 1, 1981, Montana Board of Professional Engineers & Land Surveyors

• - corner this sheet