## INSTRUCTIONS

Original and/or subsequent record used to evaluate the corner position

2. Description of evidence found, note discrepancies in the record, state method of establishing lost or obliterated

- 3. Description of monument and accessories set to perpetuate the corner position.

  4. Sketch of corner, show all pertinent data which can best be shown in a sketch example, corner marking. topography ties, position of accessories, etc.

  5. Certification must be signed and sealed by Land Surveyor registered in the State of Montana.

  6. Fill in Cross Index & Section Diagram at bottom of sheet.

## CERTIFIED CORNER RECORDATION

\_\_\_\_\_ T. <u>31N</u> R. <u>30W</u> P.M.M. <u>Lincoln</u> Corner M.C. Sec. 29 & 32 Original GLO Notes: Set a granite stone 22x12x4 in. 17" in the ground for meander corner of fractional Sec. 29 & 32, mkd. M.C. on W. face w/ 1 groove on S. face, from which:

A fir 16" bears N22 45'E 77 lks., mkd. T31N R30W S29 MC BT.

A fir 18" bears S14 E 60 lks., mkd. T31N R30W S32 MC BT. (1898 by Paul S.A. Bickel) Corner monumentation Survey: A 31 BLM brass cap set on a 30 long iron pipe 2½" diam., 27" deep at corner. Corner stone alongside. From which original bearing trees: Mkd: T31N S29 A Stump 22" bears N22045'E 771ks, no visible scribes. MC S32

R30W New bearing trees: 1964

A 10" fir bears  $550^{9}$ W 6.links , mkd. T31N R30W S32 MC BT. An 8" fir bears N84°W 27.links , mkd. T31N R30W S29 MC BT. (1964 by Gerald F. Pittman, Cadastral Surveyor)

Found a BLM 3½" brass cap on a 2" iron pipe monument near edge of steep bank to Kootenai River.(4' dist.)

Existing Bearing trees:

A stump 27" bears N23°E 51.5 feet, no visible scribes. (Original Arotted stump bears S14°E 38.6 feet, no visible scribes.

A fir 15" bears  $854^{\circ}W$  3.6 feet, scribe overgrown. A fir 12" bears  $89^{\circ}W$  17.7 feet, scribe overgrown.


Decl. 20°E Assumed.

New bearing tree:

A 6" fir bears N58°E 48.1 feet, mkd. T31N R30W S29 MC BT.

All BT's painted and signed as per USFS Spec's. A rock cairn 3' diam. built around monument & ground cleared to 6' diam. Set sign post near cor.

Cor. Mkd: T31N S29 MC 832 **R30W** 1964

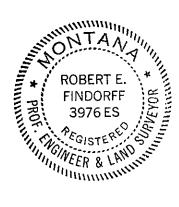

Dentily w/ magni certify the information shown herein is true and correct. Signature Ground Party Chief Robert E. Findorff ctly represents work performed compliance with Abb "Corner eriify...that this Corner B. Date:1/11/87 Reg. No. 3976 F. Employer: Self

**SKETCH OF CORNER** (SEE ABOVE)

Office of Clerk and Recorder, County of Lincoh. This "corner	Sec. 32.T31N.R30W
record" was filed for record on 16,1987	
was noted on the cross-index plat and is assigned page No. 3697 in -	
book No and the Sugel by Siel Dischill	
County Official Deputy	

Cross Index No. V-7,8 T. 31N R. 30WPMM
Adopted July 1, 1981, Montana Board of Professional Engineers & Land Surveyors

(Orig.)