

## INSTRUCTIONS

1. Original and/or subsequent record used to evaluate the corner position.
2. Description of evidence found, note discrepancies in the record, state method of establishing lost or obliterated corners.
3. Description of monument and accessories set to perpetuate the corner position.
4. Sketch of corner, show all pertinent data which can best be shown in a sketch example, corner marking, topography ties, position of accessories, etc.
5. Certification must be signed and sealed by Land Surveyor registered in the State of Montana.
6. Fill in Cross Index & Section Diagram at bottom of sheet.

## CERTIFIED CORNER RECORDATION

Corner Cor. Sec. 33 & 34 T. 31N R. 30W P.M.M. Lincoln County  
Cor. Sec. 4 & 3 30N 30W Lincoln

Original GLO Notes: Set a granite stone 18x10x8 in. 12" in the ground for cor. of Sec. 3, 4, 33, & 34, marked w/ 3 notches on E. & W. edges, from which:  
 A pine 7" bears N22°E 61 lks., mkd. T31N R30W S34 BT.  
 A pine 24" bears S11°E 33 lks., mkd. T30N R30W S3 BT.  
 A pine 24" bears S40°5'W 115 lks., mkd. T30N R30W S4 BT.  
 A pine 7" bears N19°50'W 63 lks., mkd. T31N R30W S33 BT.  
 (1898 by Paul S.A. Rickel)

Corner monumentation survey: The corner to Sec. 3, 4, 33, & 34 on S. Bdry of Twp., determined from remains of original bearing trees. At corner point set an iron post, 30" long, 2½" diam, 26" in ground, w/ brass cap mkd: from which: The original bearing trees:

A snag, 13" bears N22°E 61 lks., with overgrown blaze. T31N R30W  
 A stump hole bears S11°E 33 lks., with fallen log mkd. S33 | S34  
 T30N R30W S3 BT. (Record) S4 | S3  
 A rotted stump bears S40°5'W 125 lks., no marks. T30N  
 A pine 11" bears N19°50'W 63 lks., mkd. T31N R30W S33 BT. T30N  
 1965

The new bearing trees:

A pine 17" bears S64°E 181 lks., mkd. T30N R30W S3 BT.  
 A pine 19" bears S72°W 70 lks., mkd. T30N R30W S4 BT.  
 A fir 12" bears N38½°W 86 lks., mkd. T31N R30W S33 BT.  
 (1965 by Duane G. Lindenberg, Cadastral Surveyor)

Found a BLM 3½" brass cap on a 2" iron pipe monument on a steep sidehill to SE.

Found existing bearing trees:

MKD: A 20" pine bears S63°E 115.1 feet, blaze mostly overgrown.  
 T31N R30W A rotted stump bears S38°W 82.5 feet, no visible scribe. (original)  
 S33 | S34 A 24" pine bears S74°W 45.8 feet, scribe visible.  
 S4 | S3 A 13" pine bears N35°W 53.1 feet, scribe visible.  
 T30N A 11" fallen pine bears N20°W 41.6 feet. (Original)


1965 New Bearing tree:

A 12" pine bears N10°E 59.1 feet, mkd. T31N R30W S34 BT.

Decl. 20°E  
 Assumed.

All BT's painted and signed as per USFS specs. Built a rock cairn 3' diam around mon. and cleared ground to 6' diam. Set sign post near mon.

Cor. Mkd: T31N R30W  
 S33 | S34  
 S4 | S3  
 T30N  
 1965

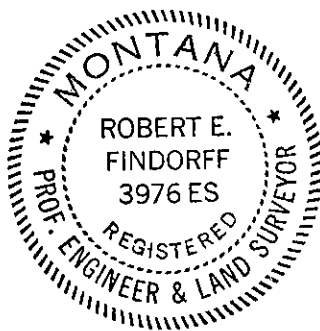


| CERTIFICATION  |                        |
|--|------------------------|
| I, <u>Robert E. Findorff</u>   |                        |
| certify the information shown herein is true and correct.  |                        |
| Signature Ground Party Chief   |                        |
| I, <u>Robert E. Findorff</u>   |                        |
| certify that this Corner Record correctly represents work performed by me or under my direction in compliance with the "Corner Recordation Act" (M.C.A. 82-101, et seq., M.C.A.) |                        |
| Signature of Surveyor & Seal   |                        |
| Date: <u>11/11/87</u>  | Reg. No. <u>3976ES</u> |
| Employer: <u>Self</u>  |                        |

SKETCH OF CORNER (SEE ABOVE)

Office of Clerk and Recorder, County of Lincoln. This "corner record" was filed for record on Nov 16, 1987 was noted on the cross-index plat and is assigned page No. 3703, in book No. \_\_\_\_\_

Cross Index No. 2-13 T. 31N R. 30W PMM

Adopted July 1, 1981, Montana Board of Professional Engineers & Land Surveyors

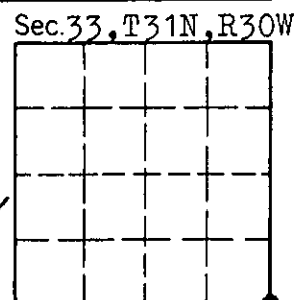

• corner this sheet