Original and/or subsequent record used to evaluate the corner position.
 Description of evidence found, note discrepancies in the record, state method of establishing lost or obliterated

Sketch of corner, show all pertinent data which can best be shown in a sketch example, corner marking, topography ties, position of accessories, etc.
 Certification must be signed and sealed by Land Survivors readers.

Certification must be signed and sealed by Land Surveyor registered in the State of Montana 6, Fill in Cross Index & Section Diagram at bottom of sheet.

## CERTIFIED CORNER RECORDATION

Corner Sec. 28, 29, 32, & 33 T. 31N R. 30W P.M.M. Lincoln

Original GLO Notes: Set a granite stone 12x12x9 in. 8" in ground for Cor. of Sec. 28, 29, 32, & 33, mkd. w/ 1 notch on S and 4 notches on E. edges. From which: A tamarack 24" bears N59 10'E 95 lks., mkd. T31N R30W S28 BT. A Pine 7" bears S43 30'E 82 lks., mkd. T31N R30W S33 BT. A Pine 32" bears S6 50'W 97 lks., mkd. T31N R30W S32 BT. A tamarack 18" bears N70 10'W 26 lks., mkd. T31N R30W S29 BT.

(1898 by Paul S.A. Bickel)

Corner monumentation survey: The corner of sec. 28, 29, 32, & 33, as determined from the remains of the original bearing trees. At the corner point, set an iron post, 30" long, 21" in diam., 27" in the T31N Ř30W ground, with brass cap mkd.

S29 S32 1964

from which

The remains of the original bearing trees:

A larch 24" bears N28°E 95 lks., visible marks T31N R30W.

(Record N59°10'E)

A pine 18" bears S43½°E 82 lks., blaze overgrown.

A decayed stump bears S7°W 97 lks., no marks visible.

A larch 18" bears N78°W 26 lks., visible marks R30W S29.

Found a BLM  $3\frac{1}{2}$ " brass cap on a 2" iron pipe w/corner stone alongside. Found bearing trees:

Mkd: T31N **R30W** 

S29 S28 \$32 S33


1964

Decl. 20°E Assumed.

A tamarack 24" N30°E 62.8 feet, scribe visible.(Original) A pine 20" S42°E 55.7 feet, scribe not visible.(Original) A pine stump (decayed) 32" record, S8°W 65.7 feet, scribe not A fir 14" S16°W 18.7 feet, scribe not visible. (Original) Fd A tamarack 24" N76°W 17.3 feet, scribe visible,(Original) All BT's painted and signed as per USFS Specs. and a post set near corner w/ signs attached. Built a rock cairn with stones found (not to spec.) and cleared to 6' diam.

A two track road falls 40 feet, more or less East of cor.

**R30W** . Cor Mkd: T31N **S28** \$33 S32 1964

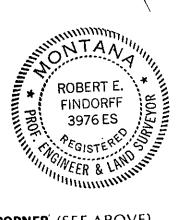

CERTIFICATION certify the information shown herein is true and correct. Signature Ground Party Chief

Robert E. Findorff

 $_{\rm Dale} 1/25/87_{\rm Reg. No.} 3976ES$ 

Self

**SKETCH OF CORNER** (SEE ABOVE)

. This "corner Office of Clerk and Recorder, County of Nec 10, 1987 record" was filed for record on ... was noted on the cross-index plat and is assigned page No. book No... County Official

Sec. 33.T31N<u>.R30</u>W

T. 31N R. 30W PMM <u>v-9</u> Cross Index No. Adopted July 1, 1981, Montana Board of Professional Engineers & Land Surveyors