INSTRUCTIONS

- 1. Original and/or subsequent record used to evaluate the corner position.
- 2. Description of evidence found, note discrepancies in the record, state method of establishing lost or obliterated corners.
- 3. Description of monument and accessories set to perpetuate the corner position.
- 4. Sketch of corner, show all pertinent data which can best be shown in a sketch example, corner marking, topography ties, position of accessories.
- 5. Certification must be signed and sealed by Land Surveyor registered in the State of Montana.
- 6. Fill in Cross Index & Section Diagram at bottom of sheet.

CERTIFIED CORNER RECORDATION

Corner: <u>Section Corner</u>, <u>Secs 3, 4, 33 & 34</u> T. <u>31 & 32N</u>. R. <u>34W</u>.

P.M.M. Lincoln Count

GLO Record:

Set limestone and established 4 bearing trees.

1982 Record:

Did not find original stone, falls in road.

(Staab 5619S)

Found: Rotten Stump, bears N23°30'E, 50 lks (33.0 ft.), w/ large overgrown blaze

Pine, 30 ins. dia., bears S34°E, 30 lks (19.8 ft.), w/ visible scribe

Set a 32 ins. x 3-1/2 ins. dia. alum. pipe, 25 ins. in the ground w/ alum. cap. Raised a collar of stone around monument. From which:

Hemlock, 7 ins. dia., bears N68°E, 58 lks (38.3 ft.), marked "T32N R34W S34 BT" Cedar, 16 ins. dia., bears S73°W, 78 lks (51.5 ft.), marked "T31N R34W S4 BT" Hemlock, 8 ins. dia., bears N30°W, 79 lks (52.1 ft.), marked "T32N R34W S33 BT"

2010 Found:

We find a 3-1/4 ins. dia. alum cap, marked as shown below, on 2-1/2 ins. dia. pipe, rising 0.4 ft. from a mound of stone, from which:

Hemlock, 9 ins. dia., bears N72°E, 24.1 ft., (Record N68°E, 38.3 ft.), scribed

"T32N R34W S34 BT" w/ BT tags

White Pine snag, 24 ins. dia., bears S29°E, 20.0 ft., w/ partially overgrown blaze, scribed "3" Cedar, 14 ins. dia., bears S76°W, 51.8 ft. (Record S73°W), scribed "T31N R34W S4 BT" w/ BT tags


2010 Perpetuation:

We establish new reference monuments as follows:

Hemlock, 7 ins. dia., bears S21°E, 21.8 ft., scribed "T31N R34W S3 BT" There are no suitable trees for a BT in Section 33, area has been heavily logged.

We set galvanized steel posts, West, 1.8 ft. and East, 1.85 ft. from the monument w/ LSM and USFS boundary decals.

Bearing trees were affixed with BT tags, snow blazed and a painted red band.

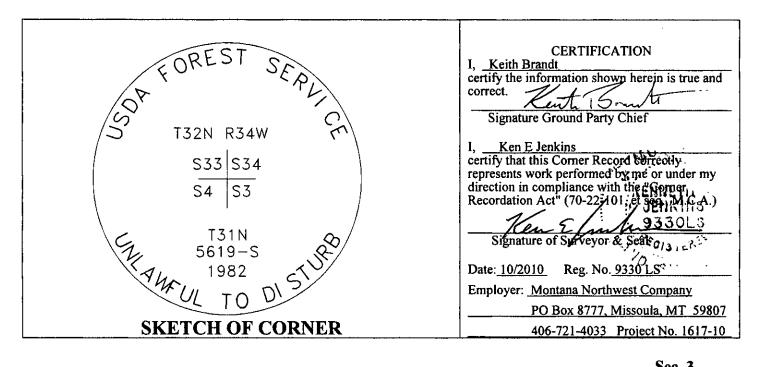

			30	ic. 5
Office of Clerk and Recorder, Cou	unty of	. This "corner		
	231788 BOOK: CCR CCGR'S	PAGE: 11757 Pages: 1	1	
record" was filed for record on str	ATE OF MONTANA LINCOLN COUNTY			
REC	CORDED: 03/30/2011 11:08 KOI:	CCER'S		
was noted on the cross-index pl	MMY D. LAUER CLERK AND RECORD	ER LO_		
book No.	E: \$0.00 BY:	ne Leaner Sinch		
	MMY D. LAUER CLERK AND RECORD E: \$0.00 BY: : MONTANA MORTHWEST COMPANY P.O. BO	OX 8777, MISSOULA, MONTANA		

County Official