INSTRUCTIONS

- Original and/or subsequent record used to evaluate the corner position.
 Description of evidence found, note discrepancies in the record, state method of establishing lost or obliterated
- 3. Description of monument and accessories set to perpetuate the corner position
- Sketch of corner, show all pertinent data which can best be shown in a sketch example, corner marking, topography ties, position of accessories, etc.
 Certification must be signed and sealed by Land Surveyor registered in the State of Montana.
 Fill in Cross Index & Section Diagram at bottom of sheet.

CERTIFIED CORNER RECORDATION

Corner <u>Se</u>	c30	<u> & C</u>	<u>.31</u>	T. <u>32N</u>	_R. <u>29</u> W	_P.M.M. <u>_Lincoln</u>	County
Se	c. 25	5 &	36	32N	30W	Lincoln	

Original GLO Notes: Set a trachite stone 26x10x10", 19" in ground for cor. sec. 25, 30, 31, & 36, marked w/ 1 notch on S. and 5 notches on N. edges; from which:

A pine 36" bears N46°E 35 lks., mkd. T32N R29W S30 BT. A fir 15" bears S57°30'E 10 lks., mkd. T32N R29W S31 BT. A tamarack 16" bears S41°45'W 72 lks., mkd. T32N R30W S36 BT. A fir 20" bears N25°15'W 40 lks., mkd. T32N R30W S25 BT. (1902 by Paul S.A. Bickel)

Dependent Resurvey of Township Line: The cor. of sec. 25, 30, 31, & 36; a trachite stone 26x10x10, marked & witnessed as described in the official record, except that the NE bearing tree has fallen.

In place of stone set an iron post 3' long, 2" diam., 28" in ground, for cor. of sec. 25, 30, 31, & 36, with the stone set flush with the surface on the W. side of the post, with brass cap mkd: $$_{\rm T32N}$$

R30W R29W S25 1940

From which:

A fir 18" bears N15⁰30'E 58 lks., mkd. T32N R29W S30 BT.

(1940 by Ranney Y. Lyman, Cadastral Surveyor)
Found a 3½" brass cap on a 2" diam iron pipe monument bent over badly in a stone pile for cor. mon. Straightened iron pipe and rebuilt rock cairn to 3' diam. around mon. and cleared ground to 6' diam.

From which: A dead snag 3ears N15°E 30.0 feet, scribe visible.

A 12" stump bears S48°E 6.8 ft., blazed but scribe not seen.

A 13" dead Tam. snag bears S39°W 47.7 feet, blazed.

A 17" dead snag bears N26°W 27.0 feet, blazed.

New Bearing trees: A 5" tamarack bears N41°E 20.0 feet, mkd T32N R29W S30 BT.

A 20" tamarack bears S78°E 9.9 feet, mkd T32N R29W S31 BT.

A 7" fir bears S51°W 16.3 feet, mkd. T32N R30W S36 BT.

A 11" fir bears N22°W 27.7 feet, mkd. T32N R30W S25


Set a steel sign post near corner. Painted & signed all BT's as per spec's.

Cor. Mkd:

Decl. 20°E

Assumed.

T32N R30W R29W S25 S30 S36 S31 1940

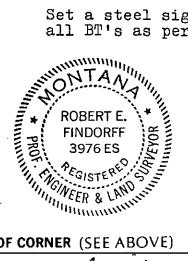

. fPighthistP#FithAb#ff rtify the information shown herein is true and correct. Signature Ground Party Chief Robert E. Findorff pat this Corner Record correc /12/87_{Reg. No.} oloyer: <u>Self</u>

РММ

SKETCH OF CORNER (SEE ABOVE)

Office of Clerk and Recorder, County of Lincohn	This "corner	Sec. 31, T32N, R29W
record" was filed for record on	· · · · · · · · · · · · · · · · · · ·	
was noted on the cross-index plat and is assigned page No	1692, in	
book No Sant Of Sugel 1	Cial Deputy	
77 4	70M 00W	

Adopted July 1, 1981, Montana Board of Professional Engineers & Land Surveyors

corner this sheet