

INSTRUCTIONS

1. Original and/or subsequent record used to evaluate the corner position.
2. Description of evidence found, note discrepancies in the record, state method of establishing lost or obliterated corners.
3. Description of monument and accessories set to perpetuate the corner position.
4. Sketch of corner, show all pertinent data which can best be shown in a sketch example, corner marking, topography ties, position of accessories, etc.
5. Certification must be signed and sealed by Land Surveyor registered in the State of Montana.
6. Fill in Cross Index & Section Diagram at bottom of sheet.

CERTIFIED CORNER RECORDATION

Corner SW Cor. Sec. 31(Twp. Cor.) T. 32N R. 29W P.M.M. Lincoln County

Original GLO Notes: Set a slate stone 20x16x14 in. 15" in the ground for Cor. of Twp. 31 & 32 N, and R29 & 30 W, mkd., with 6 notches on each edge from which:

A tamarack 18" bears N41°30'E 28 lks, mkd. T32N R29W S31 BT.
 A tamarack 10" bears S8°10'E 13 lks, mkd. T31N R29W S6 BT.
 A tamarack 18" bears S63°40'W 49 lks, mkd. T31N R30W S1 BT.
 A tamarack 12" bears N48°W 102 lks, mkd. T32N R30W S36 BT.
 (1898 by Paul S.A. Bickel)

Resurvey of Township Lines in 1939 by, Ranney Y. Lyman, Cadastral Surveyor.

The corner of Twp. 31 & 32 N. and R29 & 30 W; a slate stone 20x16x14 in, and mkd. and witnessed as described in the official record.

In place of stone: Set an iron post, 3' long, 3" dia., 28" in ground, for cor. of Ts 31 & 32 N, Rs. 29 & 30 W., with brass cap mkd:

		T32N
R30W		R29W
S36		S31
S1		S6
		T31N
		1939

Found a 4" GLO cap (brass) on 3" iron pipe monument w/ GLO corner stone buried South of mon.


Found bearing trees: 24" Tamarack N45°E 18.5 ft., Original BT, Blaze healed.
 14" Tamarack S52°E 29.2 ft., Blaze healed over. No record.
 12" Stump S10°E 9.4 ft., original BT.
 20" Stump S62°W 32.0 ft., original BT., Blaze visible.
 7" Tamarack S65°W 23.7 ft., No blaze. Blazed and scribed T31N R30W S1 BT. No record.
 9" Fir N75°W 28.9 ft., No blaze. Blazed and scribed T32N R30W S36 BT. No record.
 All BT's painted and signed as per spec's.. Set a sign post near corner. Built a rock cairn 3' dia. around corner mon. and cleared the area to a 6' dia.

Decl. 20°E
 Assumed.

Cor. MKD: T32N

R30W		R29W
S36		S31
S1		S6
		T31N
		1939

Corner falls about 450' south of F.S. road on side-hill to South.

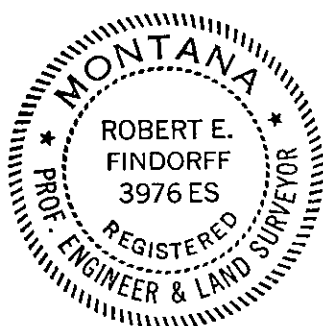

CERTIFICATION	
I, <u>Robert E. Findorff</u>	
certify the information shown herein is true and correct.	
Signature Ground Party Chief	
1. <u>Robert E. Findorff</u>	
certify that this Corner Record correctly represents work performed by me or under my direction in compliance with the "Corner Recordation Act" (70-22-301, et seq., M.C.A.)	
Signature of Surveyor & Seal	
Date: <u>11/25/87</u>	Reg. No. <u>3976ES</u>
Employer: <u>Self</u>	


SKETCH OF CORNER (SEE ABOVE)

Office of Clerk and Recorder, County of Lincoln. This "corner record" was filed for record on Dec. 22, 1987 was noted on the cross-index plat and is assigned page No. 3788, in book No.

Cross Index No. Z-1 T. 32N R. 29W P.M.M.

Adopted July 1, 1981, Montana Board of Professional Engineers & Land Surveyors

Sec. 31, T32N, R29W

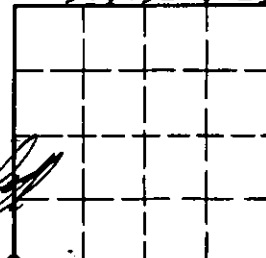

• - corner this sheet