INSTRUCTIONS

- 2. Description of evidence found, note discrepancies in the record, state method of establishing lost or obliterated
- 3. Description of monument and accessories set to perpetuate the corner position
- 4. Sketch of corner, show all pertinent data which can best be shown in a sketch example, corner marking, topography ties, position of accessories, etc.
- 5. Certification must be signed and sealed by Land Surveyor registered in the State of Montana.
- 6. Fill in Cross Index & Section Diagram at bottom of sheet.

CERTIFIED CORNER RECORDATION

Corner Sec. Cor to Sec. 17 & 20 T. 32N R. 30W P.M.M. Lincoln

Original GLO Notes: A sandstone 16x8x6 in., 10" in ground for Cor. to Sec. 16, 17, 20, & 21 mkd. w/3 notches on S. & 4 notches on E. edges. from which:

A fir 18" bears N36½ E 138 lks. mkd. T32N R30W S16 BT.

A tamarack 16" bears S25½ E 32 lks. mkd. T32N R30W S21 BT.

A tamarack 16" bears S59 W 15 lks. mkd. T32N R30W S20 BT.

A fir 14" bears N68 W 59 lks. mkd. T32N R30W S17 BT.

(1916 by: Mans H. Coffin, Jr., R. Fitzhugh Maclean, & James R. Cumming)

1940 Dependent Resurvey: An iron post 3' long, 2" dia., 28" in ground set at GLO corner stone fd., a slate stone 16x10x4 in. above ground. Buried stone on W. side of post flush w/ ground. Brass cap mkd: T32N R30W (Ranney Y. Lyman, Cadastral Engineer)


<u>\$17</u> | \$21 1940

Found 1940 brass capped ($2\frac{1}{2}$ ") iron pipe for Sec. Cor. to Sec. 17 & 20. No stones around post. Mkd. T32N R30W

S17 S21

1940
Existing BT's: 22" tamarack S18°E 20.7', blaze healed over.(orig. BT)
24" stump(Fallen) N72°W 37.8'(Orig. BT)
20" Tamarack(standing dead) S61°W 9.8'(Orig. BT) blaze closed.

New BT's: 12" Red Cedar N32°W 19.3' mkd. T32N R30W S17 BT.
10" Lodgepole Pine S53°W 16.6' mkd. T32N R30W S20 BT.
All BT's signed and painted as per USFS Specs. No stones for rock cairn found. Sign Post set.

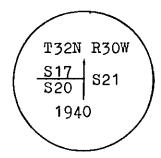

SKETCH OF CORNER (SEE ABOVE)

CERTIFICATION
I PHINIPPH
certify the information shown herein is true and correct.
Signature Ground Party Chief
, Robert E. Findorff
certify that his farner Record correctly represents work performed
by me of under my direction compliance with the Corner
Record tion (ct" 10.72.101; et seq. M.C.A.)
10m - mass
Signature of Surveyor & Seal
Date: 9/12/87eg. No. 3976ES
Employer: Self

· · · · · · · · · · · · · · · · · · ·	i	
Office of Clerk and Recorder, County of Lincoln	This ''corner	Sec. 17, T32N, R30W
record" was filed for record on Nov 16, 1987		
was noted on the cross-index plat and is assigned page No. 370	06 in 1	, +-+
book No County Office	ial Deputy	
	<i>/ / /</i>	L

. т. <u>32N</u> r. <u>30W</u> рмм N9 Cross Index No. . Adopted July 1, 1981, Montana Board of Professional Engineers & Land Surveyors corner this sheet