

1. Original and/or subsequent record used to evaluate the corner position.
2. Description of evidence found, note discrepancies in the record, state method of establishing lost or obliterated corners.
3. Description of monument and accessories set to perpetuate the corner position.
4. Sketch of corner, show all pertinent data which can best be shown in a sketch example, corner marking, topography ties, position of accessories,
5. Certification must be signed and sealed by Land Surveyor registered in the State of Montana.
6. Fill in Cross Index & Section Diagram at bottom of sheet.

CERTIFIED CORNER RECORDATION

Corner: 1/4 Corner, Sections 18 & 19 T. 32N. R. 34W. P.M.M. Lincoln County

1968 Record: Per Certified Corner Recordation, Book 1, Page 115.
(Ninneman) Original corner and bearing trees destroyed by logging operation.
We replaced w/ brass cap 2640 ft. west of section corner common to sections 17, 18, 19 & 20, T.32N, R.34W, MPM and on a straight line between said section corner and the section corner common to sections 18 & 19, T.32N., R.34 W. and section 13 & 14 T.32N., R35W., MPM

1982 Record: No evidence of original monument or accessories was found.
(Hill 5612 S) Found brass cap as per the 1968 Ninneman survey. Established a corner position by single proportionate measurement along the section line. From this position, the found brass cap bears N59°42'W, 10.00 ft. Rejected the position occupied by the brass cap because: 1.) The position was determined by improper methods, and 2.) a gross error existed in the reported measurement.

At the established single proportionate position, set a 2-1/2 ins. dia. x 30 ins. alum. pipe, 24 ins. in the ground with a collar of stone. From which:

Fir, 20 ins. dia., bears N78°E, 27.7 ft., mkd "1/4 S18 BT"

Fir, 5 ins. dia., bears S19°W, 6.2 ft., mkd "1/4 S19 BT"

2010 Found: We find a 3-1/4 ins. dia. alum. cap, as shown below, 2-1/2 ins. dia. alum. pipe, rising 0.1 ft. from a collar of stone. From which:

Fir, Blown down and uprooted, 20 ins. dia., bears N74°E, 27.1 ft., face blaze, no visible scribing

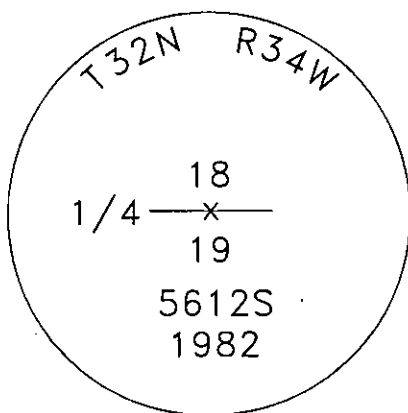
Larch, 8 ins. dia., bears S05°W, 6.2 ft., (Record S19°W), w/ overgrown blaze, no visible scribing

We also find the brass cap set by the 1968 survey. This brass cap bears N59°W, 10.5 ft., from the alum. cap set by the 1982 survey.

2010 Perpetuation: We establish new reference monuments as follows:
Douglas Fir, 6 ins. dia., bears N13°E, 30.9 ft., scribed "T32N R34W S18 BT"

We set galvanized steel posts, North, 1.6 ft. and East, 5.6 ft. from the monument w/ LSM and USFS boundary decals.

Bearing trees were affixed with BT tags, snow blazed and a painted red band.

**SKETCH OF CORNER****CERTIFICATION**

I, Keith Brandt
certify the information shown herein is true and correct.

Keith Brandt
Signature Ground Party Chief

I, Ken E Jenkins
certify that this Corner Record correctly represents work performed by me or under my direction in compliance with the "Corner Recordation Act" (70-22-101, M.C.A.)

Ken E Jenkins
Signature of Surveyor & Seal

Date: 9/2010 Reg. No. 9330 LS

Employer: Montana Northwest Company

PO Box 8777, Missoula, MT 59807

406-721-4033 Project No. 1617-10

Sec. 18

Office of Clerk and Recorder - County of Lincoln This "corner
record" was filed for record 231813 BOOK: CCR CCR'S PAGE: 11782 Pages: 1
STATE OF MONTANA LINCOLN COUNTY
RECORDED: 03/30/2011 11:32 KOI: CCR'S
was noted on the cross-index TAMMY D. LAUER CLERK AND RECORDER
book No. 5612S FEE: \$0.00 BY: Tammy D. Lauer
TO: MONTANA NORTHWEST COMPANY P.O. BOX 8777, MISSOULA, MONTANA

Tammy D. Lauer
County Official

