- 1. Original and/or subsequent record used to evaluate the corner position.
- 2. Description of evidence found, note discrepancies in the record, state method of establishing lost or obliterated corners.
- 3. Description of monument and accessories set to perpetuate the corner position.
- 4. Sketch of corner, show all pertinent data which can best be shown in a sketch example, corner marking, topography ties, position of
- 5. Certification must be signed and sealed by Land Surveyor registered in the State of Montana.
- 6. Fill in Cross Index & Section Diagram at bottom of sheet.

## CERTIFIED CORNER RECORDATION

1/4 Sec Corner

Corner: Sections 2 & 35

T. 31 & 32N. R. 34W. P.M.M. Lincoln County

1967 BLM Record:

Set 2-1/2 ins. dia. iron pipe w/ brass cap and established 2 bearing trees.

Buried original stone alongside

1982 Record:

Found a 2-1/2 ins. dia. brass cap.

(Hill 5612S)

From which:

Larch, 28 ins. dia., bears S05°W, 16.1 ft. w/ healed face Cedar, 7 ins. dia., bears N38°E, 16.1 ft., w/ visible scribing

2010 Found:

We find a 3-1/4 ins. dia. BLM brass cap, marked as shown below, on 2-1/2 ins. dia. pipe,

rising 0.2 ft. from the ground.

From which:

Cedar, 16 ins. dia., bears N37°E, 16.2 ft., w/ partial scribing & BT tag Larch down fall, 28 ins. dia., bears S05°W, 18.0 ft., w/ no visible scribing Cedar, 16 ins. dia., bears S33°W, 22.6 ft., scribed "1/4 S2 BT" & BT tag


2010 Perpetuation:

We establish no new reference monuments.

We set a galvanized steel post, bears West, 0.6 ft. from the monument w/ LSM and USFS

boundary decals.

Bearing trees were affixed with BT tags and a painted red band.

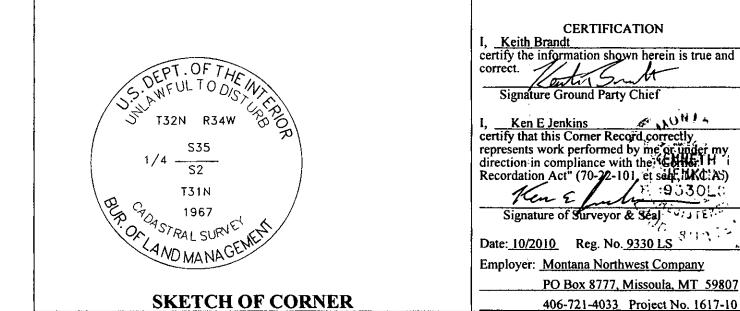

		Sec. 35	;
Office of Clerk and Recorder, Count	y of This "corner	1	
	231891 BOOK: CCR CCER'S PAGE: 11834 Pages: 1 STATE OF MONTANA LINCOLN COUNTY RECORDED: 03/31/2011 10:09 KOI: CCER'S		
book No.	THEE: \$0.00 BY: Same Seure To: MONTANA HORTHWEST COMPANY P.O. BOX 6777, MISSOULA, MONTANA  County Official		