

## INSTRUCTIONS

1. Original and/or subsequent record used to evaluate the corner position.
2. Description of evidence found, note discrepancies in the record, state method of establishing lost or obliterated corners.
3. Description of monument and accessories set to perpetuate the corner position.
4. Sketch of corner, show all pertinent data which can best be shown in a sketch example, corner marking, topography ties, position of accessories, etc.
5. Certification must be signed and sealed by Land Surveyor registered in the State of Montana.
6. Fill in Cross Index & Section Diagram at bottom of sheet.

## CERTIFIED CORNER RECORDATION

Corner E 1/4 of Sec. 36 T. 34N R. 25W P.M.M. Lincoln County

- I. 1894 Original GLO Record: North bet. secs. 31 and 36....  
 At 37.85 chs., a tamarack, 12 ins. diam., on line, mkd. with 2 notches on the N. and S. sides.  
 At 38.40 chs., the Stillwater River, 60 lks. wide, coarse SE.  
 At 40.00 chs.,  
 Set a post, 3 ft. long, 3 ins. square, 24 ins. in the ground, for  $\frac{1}{4}$  sec. cor., marked  $\frac{1}{4}$  S. on W. face; from which:  
 A spruce, 8 ins. diam., bears S.  $87^{\circ}45'E$ . 13 lks. dist., marked  $\frac{1}{4}$  S.B.T.  
 A pine, 10 ins. diam., bears S.  $15^{\circ}15'W$ . 41 lks. dist. marked  $\frac{1}{4}$  S.B.T.  
 At 43.00 chs., Stryker's barn bears E. 50 lks.
- II. After an extensive search of the area, I found no evidence of either the original wood post nor the original bearing trees since their positions, as determined using topographic calls and verified by survey, falls in a dried abandoned channel of the Stillwater River. However, Stryker's log barn, as called in the original notes, still exists in its original position. Also found was a twin larch, 48 in. diam., on line and at record distance from the section corner south, with healed scars N. and S. faces, and on the South bank of the Stillwater River. Using the record larch as the best available evidence, I set the  $\frac{1}{4}$  corner of sections 36 and 31, on line between the line tree and the NE section corner and at proportionate distance. This position is substantiated by the call to Stryker's barn.
- III. At the determined corner position, I set a  $2\frac{1}{2} \times 30$  in. aluminum pipe, 22 ins. in the ground, with a  $\frac{3}{4}$  in. aluminum cap, mkd. as shown, from which:


T34N  
 1/4  
 R25W, R24W  
 636 | 631  
 5612-8  
 1986

I established two references:

A spruce, 5 ins. diam., bears S.  $66^{\circ}E$ , 50.6 ft. dist., mkd. T34N R24W  $\frac{1}{4}$  S31 BT.  
 A cottonwood, 15 ins. diam., bears S.  $71^{\circ}W$ , 44.6 ft. dist., mkd. "X BT".  
 I set a 6 ft. galvanized steel guard post with a Survey Marker decal attached, South, 1.4 ft. dist. I painted red bands around bearing trees and attached BT and Land Survey Monument signs.

(OVER)

15" COTTONWOOD

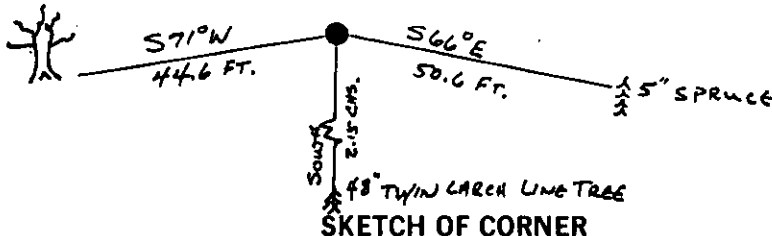

## CERTIFICATION

I, Douglas R. Maday

certify the information shown herein is true and correct.

Douglas R. Maday  
 Signature Ground Party Owner

I, Thomas C. Hill

certify that this Corner Record correctly represents work performed by me or under my direction in compliance with the Corner Recordation Act (70-22-101, et seq., M.C.A. 5612-8)

Thomas C. Hill  
 Signature of Surveyor & Seal

Date: 8/86 Reg. No. 561246

Employer: U.S.F.S.

Office of Clerk and Recorder, County of Lincoln. This "corner

record" was filed for record on Sept 18, 1986


was noted on the cross-index plat and is assigned page No. 3353, in

book No. \_\_\_\_\_

Don't Be Sugal by Bill Buckhoff  
 County Official Deputy

Cross Index No. \_\_\_\_\_ T. \_\_\_\_\_ R. \_\_\_\_\_ PMM

Sec. 36

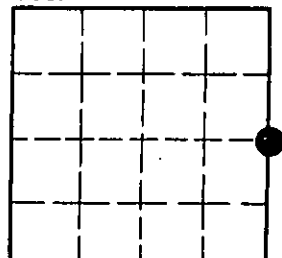

• - corner this sheet

