INSTRUCTIONS

- Original and/or subsequent record used to evaluate the corner position.
 Description of evidence found, note discrepancies in the record, state method of establishing lost or obliterated
- 3. Description of monument and accessories set to perpetuate the corner position.

 4. Sketch of corner, show all pertinent data which can best be shown in a sketch example, corner marking, topography ties, position of accessories, etc.
- 6. Fill in Cross Index & Section Diagram at bottom of sheet.

CERTIFIED CORNER RECORDATION


3 of MS 5024 Lincoln Corner . County 1896 MS original record by Abram L. Jaqueth: "Second Course, S.10 010'W. Along the right bank of

Yaak River. Set a post 5 ins. square, 4 ft. long, 2 ft. deep, marked 3-5024 for Cor. No. 3. A blazed pine tree, 10 ins. in diam., marked 3-5024 BT, bears S.74 10'W., 14 ft. dist. A blazed white pine tree, 14 ins. in diam., marked 3-5024 BT., bears N.30 35'W., 25 ft. dist."

II. Found no corner monument and no accessories.

III. At position determined by grant boundary adjustment between corners 2 and 5.

Set a 3/4 ins. diam., 30 ins long aluminum rod, 24 ins. in the ground with aluminum cap mkd. as shown:

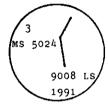

Established two new bearing trees:

A cedar, 7 ins. diam., bears $N.31^{\circ}E$., 12.8 ft. dist., mkd. 3 MS 5024 BT. A spruce, 18 ins. diam., bears $S.35^{\circ}E$., 9.8 ft. dist., mkd. 3 MS 5024 BT.


Painted red bands around the bearing trees and attached "Land Survey Monument" and "Bearing Tree" signs.

Set a galvanized steel guard post with "Land Survey Marker" and "Property Boundary" decals, S.13 E., 3 ft. dist. from corner.

Magnetic declination: 20 East

record" was filed for record on _

book No. .

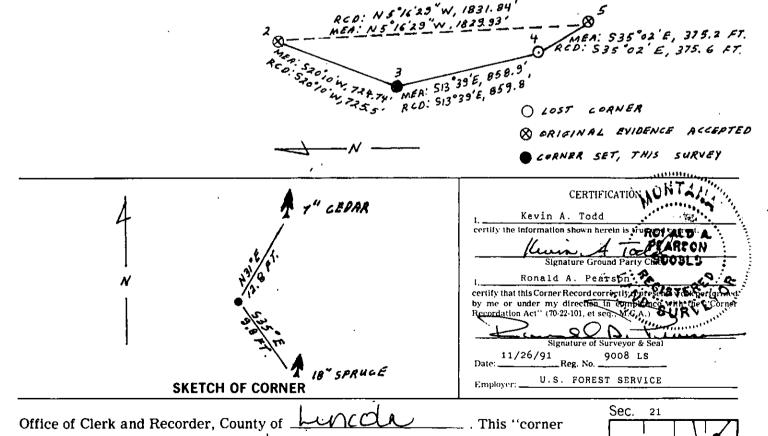

lan 16,1992 was noted on the cross-index plat and is assigned page No. 3 MS 5024 · corner this sheet Cross Index No. .