## INSTRUCTIONS

- Original and/or subsequent record used to evaluate the corner position.
- 2. Description of evidence found, note discrepancies in the record, state method of establishing jost or obliterated
- Description of monument and accessories set to perpetuate the corner position.
   Sketch of corner, show all pertinent data which can best be shown in a sketch example, corner marking, topography ties, position of accessories, etc.
- 6. Fill in Cross Index & Section Diagram at bottom of sheet.

## CERTIFIED CORNER RECORDATION


N 1/4 S 5 only T. 35 N., R. 27 W., P.M.M. Lincoln Corner\_ 1893 GLO original record by A. L. Jaqueth et al: Set a post, 3 ft. long, 3 ins. square, 24 ins. in the ground, and two bearing trees. 1903 Retracement of the Fractional N. bdry. by A. L. Rinearson et al: Set a porphyry stone, 20x16x8, 15 ins. in the ground for 1/4 sec. cor. marked on N. face, from which:

A fir, 6 ins. diam, bears N 16 1/4 E, 24 lks. dist., mkd. 1/4 S 32 BT.

A fir, 8 ins. diam., bears S 72 E, 10 lks. dist., mkd. 1/4 S 5 BT. The old 1/4 sec. cor. which is a post marked and witnessed as described by the surveyor general, I destroy. 1913 Retracement and Resurvey of the Fractional N. Bdry. by L. D. Lyman et al: The fractional resurvey of the N. lines of secs. 6, 3, 2 and 1. The N. 1/4 sec. cor. for S 5 was never reestablished. 1981 Certified Corner Recordation by D. K. Marquardt: Set aluminum cap by proportion in a collar of stone. The cap is marked as shown below. See also Certificate of Survey # 989 filed at the Lincoln County Courthouse. D. K. Marguardt T36N R27W 32 5 T35N R26W 1981 2989ES from which: A fir, 7 ins. diam., 25.73 ft. dist.

A fir, 12 ins. diam., 5.38 ft. dist.

III. Found a 2 1/2 in. diam. aluminum pipe, 17 ins. out of the ground, firmly set, with a 3 1/4 in. daim. aluminum cap mkd. as shown:

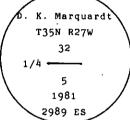

from which:

A fir, 10 ins. diam., bears N. 69 E. 26.0 ft., mkd. with a healed face.

A fir, 14 ins. diam., bears S 17 W, 5.0 ft. dist., mkd. with a healed face.

NOTE: The cap on this monument is marked incorrectly as this 1/4 sec. corner refers to sec. 5 only. Painted a red band around each bearing tree and attached Land Survey Monument and Bearing Tree signs.

No guard post established.

Magnetic Declination: East, 20

