
CERTIFIED CORNER RECORDATION

·	·			-			·	· · · ·	<u> </u>	
Corner	W.C. to	Sec.	28&33	T.	36N	R.	27W	P.M., MT	Lincoln	County
	M.C.									

- I. 1993 Certificate of Survey by Dawn Marquardt: Set a 5/8 in. x 24 in. rebar with a plastic cap stamped "7328S".
- II. Found rebar, firmly set, protruding 3 ins. above the ground, with a yellow plastic cap mkd. "Marquardt". No bearing trees found.
- III. Accepted the position of the found rebar, and set an aluminum rod, 30 ins. long, 3/4 in. diam., 22 ins. in the ground, with a 3 1/4 in. diam. aluminum cap, mkd. as shown. Built a 2.0ft. diam. rock collar around the monument.

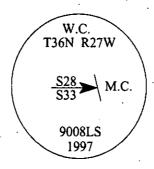

Established two bearing trees and set one steel post:


A fir, 11 ins. diam., bears S37°W, 21.4 ft. dist., mkd. "WC-MC S33 BT".

A fir, 11 ins. diam., bears S70°W, 38.4 ft. dist., mkd. "WC-MC S33 BT".

A 6 ft. steel guard post, West, on property line, 2.0 ft. dist. from the monument.

Drove the found rebar flush with the ground, next to the aluminum rod. No bearing trees available, within limits, in sec. 28, due to Othorp lake. Painted bearing trees and attached Land Survey Monument and Bearing Tree signs. Attached Land Survey Monument and Property Boundary decals to the post.

Magnetic Declination: 20° East.

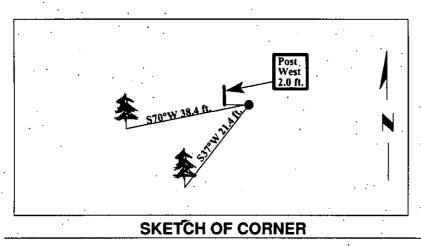

CERTIFICATION 9008L3

I. Ronald A. Pearson

certify that this Comer Record correctly represents wark performed by me or under my direction in compliance with the Corner Recordation Act (70-22-101, et seq., M.C.A.)

Signature of Surveyor & Seal

Date: 05/28/97

Reg. No.: 9008LS

Employer: U.S. FOREST SERVICE

Sec. 33

Cross Index No.

V-11.3

36N

County Official

P.M., MT