INSTRUCTIONS

- Original and or subs ent record used to evaluate the corner position.
- 2. Description of evidence found, note discrepancies in the record, state method of establishing jost or obliterated corners.

Description of monument and accessories set to perpetuate the corner position.
 Sketch of corner, show all pertinent data which can best be shown in a sketch example, corner marking, topography ties, position of accessories, etc.


5. Certification must be signed and sealed by Land Surveyor registered in the State of Montana.

6. Fill in Cross Index & Section Diagram at bottom of sheet.

CERTIFIED CORNER RECORDATION

Corner 3 Boyd Hill Cemetary (Sec.23) T. 31 W., P.M.M. 37 N., Lincoln Corner . _County

- 1954 U. S. F. S. Survey record by G. Shultz and J. Francis: As per drawing attached to U. S. F. S. Special Use Permit dated 8/18/54.
- II. Found a 1 1/4 in. diam. iron pipe, 40 ins. long, 12 ins. above ground.
- III. At the position of the found iron pipe, I set in its place a 2 1/2 in. diam by 30 ins. long aluminum pipe, 22 ins. in the ground, with a 3 1/4 in. diam. aluminum cap mkd. as shown.

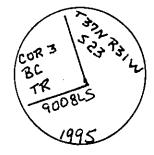

Establish two new bearing tree:

A larch, 27 ins. diam., bears N 5° E, 17.9 ft. dist., mkd. C 3 BC BT.


A larch, 21 ins. diam., bears N $61\overset{\text{O}}{\text{E}}$, 29.0 ft. dist., mkd. X BT.

Painted a red band around bearing trees and attached Land Survey Monument and Bearing Tree signs.

Set a 6 ft. galvanized steel guard post with Property Boundary and Land Survey Monument decals attached. nearby.

Magnetic Declination: 20 East.



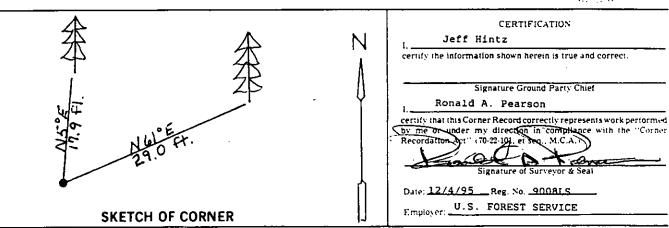

*******	•	i <u></u>	
Office of Clerk and Recorder, County of	LINCOLN	This ''corner	Sec.23
record" was filed for record on	AUG21,1997		
was noted on the cross-index plat and is a book No.	ssigned page No.	9926 in	<u> </u>
book No.	County Offic	By DER	-
	county offic		

Cross Index No. Q-18 T. 37N R. 31W PMM