INSTRUCTIONS

- 1. Original and/or subsequent record used to evaluate the corner position.
- 2. Description of evidence found, note discrepancies in the record, state method of establishing lost or obliterated corners.
- 3. Description of monument and accessories set to perpetuate the corner position.
- 4. Sketch of corner, show all pertinent data which can best be shown in a sketch example, corner marking, topography ties, position of accessories,
- 5. Certification must be signed and sealed by Land Surveyor registered in the State of Montana.

CERTIFIED CORNER RECORDATION

Corner: 1/4 Corner; Secs. 3 & 34

T. 25N. & 26N.

R. 29W. P.M.M. Lincoln County

1903 GLO Record:

Set limestone and established 2 bearing trees.

1978 BLM Record:

Found orig. stone, firmly set & marked w/ 1/4 on N. face and remains of original bearing trees.

A 24" stump, bears S75 1/2°W, 110 lks (72.6 ft.)

A 42" pine snag, bears N36°10'W, 68 lks (44.9 ft.), mk'd 1/4 S34 BT (GLO Record 57

lks)

Set an iron post 30" long, 2 1/2" diam., 22" in the ground, with brass cap. Buried orig. stone

alongside.

New bearing trees:

An 8" fir, bears S64°W, 22 lks (14.5 ft.), marked 1/4 S3 BT An 8" fir, bears N41°W, 21 lks (13.9 ft.), marked 1/4 S34 BT

2006 Record: (Staples)

Found 3 1/4" brass cap on 2 1/2" iron pipe, 7" above the ground. From which:

A 42" dead, standing, Ponderosa pine, bears N36 1/4°W, 45.86 feet distant, scribed 1/4

S34 BT

A 15" dead, standing, Douglas fir, bears N44 1/4°W, 13.88 ft., marked with a BT tag &

scribed 1/4 S34 BT

A 15" Douglas fir, healed scribe wound, bears S62 3/4°W, 14.67 ft

New bearing tree:

An 18" Douglas fir, bears N21°W, 42.89 ft., scribed 1/4 S34 BT & BT tag

2009 Found:

We find a standard BLM monument with a 3 1/4" brass cap, firmly set, in good condition, rising

6" above the ground, marked as shown below, from which:

A 15" Douglas fir, bears S63 3/4°W, 14.7 ft., with an overgrown blaze A 15" Douglas fir snag, bears N44 1/4°W, 13.9 ft., with scribing visible

A 32" Ponderosa pine snag, bears N36 1/4°W, 45.9 ft., with scribing visible

A 14" Douglas fir, bears N21°W, 42.9 ft., with scribing visible

A galvanized steel post, bears West, 1.5 ft.


2009 Perpetuation:

We establish no new reference monuments

We attached new P54-1 & P71-10 signs on steel post.

We paint red bands on the existing bearing trees, and attached USFS signs 54-3 & 54-9.

SEE COS NO. <u>3992</u>

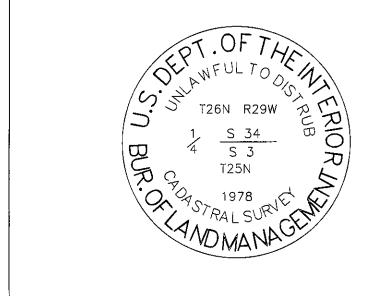

CERTIFICATION

I, Chad R. Breuer
certify the information shown herein is true and correct.

Signature Ground Party Chief

I, Ken E Jenkins
certify that this Corner Record correctly represents work performed by the informer my direction in compliance with the incorner Recordation Act" (70-22-191 cetseq., M.C.A.)

Signature of Surveyor & SealU R

Date: 8/2009 Reg. No. 9330 LS

Employer: Montana Northwest Company
PO Box 8777, Missoula, MT 59807

406-721-4033 Project No. 1617-09

SKETCH OF CORNER

	This Hasses		Sec. 5		
Office of Clerk and Recorder, County	of This "corner				
record" was filed for record on	224874 BOOK: CCR CCGR'S PAGE: 11500 Pages: 1			+	-
	STATE OF MONTANA LINCOLN COUNTY	+	-+		_
000k No	RECORDED: 03/05/2010 9:42 KOI: CCER'S TAMMY D. LAUER CLERK AND RECORDER			+	_
	TO: MONTANA MORTHWEST COMPANY P.O. BOX 8777, MISSOULA, MONTANA				-

Cross Index No.

<u>A-15</u> T. <u>25N</u> R <u>29W</u> PMM

Corner this sheet