

INSTRUCTIONS

Q:CO-STD/152
Created 4/8/92

1. Original and/or subsequent record used to evaluate the corner position.
2. Description of evidence found, note discrepancies in the record, state method of establishing lost or obliterated corners.
3. Description of monument and accessories set to perpetuate the corner position.
4. Sketch of corner, show all pertinent data which can best be shown in a sketch example, corner marking, topography ties, position of accessories.
5. Certification must be signed and sealed by Land Surveyor registered in the State of Montana.
6. Fill in Cross Index & Section Diagram at bottom of sheet.

CERTIFIED CORNER RECORDATION

Corner No. 1 Monarch MS 6185 & No. 1 Felicitas MS 6186 T. 25 N. R. 30 W. P.M.M. LINCOLN County

RECORD:

MS NO. 6185 Monarch

Corner No. 1

I commenced this survey at Cor. No. 1, identical with S.W. location corner, where I set a post, 4 1/2 ins. square, 5 ft. long, 2 ft. deep, marked 1-6185, for Cor. No. 1, and raised a mound of stone and earth around post.

The U.S.L.M. No. 6185, bears N.23°37'W., 1657.1 ft.

A blazed hemlock tree, 12 ins. diam., marked B.T. 1-6185, bears N.10°11'E., 26 ft.

MS NO. 6186 Felicitas

Corner No. 1

I commenced this survey at Cor. No. 1, identical with Cor. No. 1 of Sur. 6185 and with N.W. location corner, where is set a post, 4 1/2 ins. square, 5 ft. long, 2 ft. deep, marked 1-6185, I marked 1-6186, for Cor. No. 1, and raised a mound of stone and earth around post.

The U.S.L.M. No. 6185, bears N.23°37'W., 1657.1 ft.

A blazed hemlock tree, 12 ins. diam., marked B.T. 1-6185, bears N.10°11'E., 26 ft.

FOUND:

Found a scattered mound of stone and earth 3.5' diam., 1.5' tall. No remaining evidence of the original hemlock tree remains.

TO PERPETUATE:

At the found mound position, set a 5/8" x 24" rebar flush with the surface, with a USFS 3-1/4" aluminum cap, as shown below.

From which new trees:



A lodgepole pine, 6" in diam., blazed and scribed "1 MS 6186 BT", bears S.23°E., 5.1'.

A lodgepole pine, 7" in diam., blazed and scribed "1 MS 6186 XBT", bears S.68°W., 15.7'.

A 6" steel post with a "Land Survey Monument" decal, 2' north of monument.

Place a "Land Survey Monument" (54-9), and a "Bearing Tree" (54-3) sign on the bearing trees. Painted all blazes red, and a 6" red band above the "Bearing Tree" signs.

See Certificate of Survey, recorded in Lincoln County

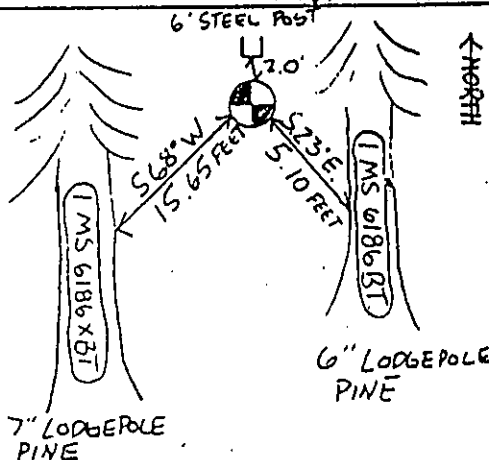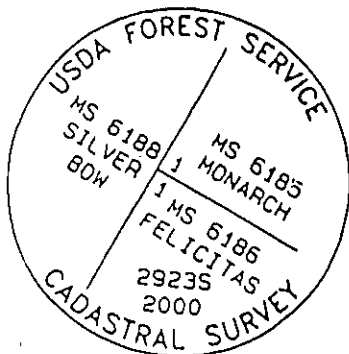

SKETCH OF CORNER

CERTIFICATION

I, Kevin Cassidy
certify the information shown herein is true and correct.

Kevin Cassidy
Signature Ground Party Chief

I, R.A. Ainsworth
certify that this Corner Record correctly represents work performed by me or under my direction in compliance with the "Corner Recordation Act" (70-22-101, et seq., M.C.A.)

R.A. Ainsworth
Signature of Surveyor & Seal

Date: 11/00 Reg. No. 2923S
Employer: Professional Consultants, Inc.

Sec. 17

Office of Clerk and Recorder, County of Lincoln. This "corner record" was filed for record on Jan 10, 2001

was noted on the cross-index plat and is assigned page No. 10471, in book No. Coral M. Cummins By DB

County Official

