

## INSTRUCTIONS

Q:CO-STD/152  
Created 4/8/92

1. Original and/or subsequent record used to evaluate the corner position.
2. Description of evidence found, note discrepancies in the record, state method of establishing lost or obliterated corners.
3. Description of monument and accessories set to perpetuate the corner position.
4. Sketch of corner, show all pertinent data which can best be shown in a sketch example, corner marking, topography ties, position of accessories.
5. Certification must be signed and sealed by Land Surveyor registered in the State of Montana.
6. Fill in Cross Index & Section Diagram at bottom of sheet.

## CERTIFIED CORNER RECORDATION

Corner No. 2 Sentinel MS 6191 & T. 25 N. R. 30 W. P.M.M. LINCOLN County  
No. 4 Pan Handle MS 6192

## RECORD:

MS No. 6191 Sentinel, Robert C. Williams, U.S. Deputy Mineral Surveyor, 1901  
Corner No. 2

1500 N.W. location corner. Set a post, 4 1/2 ins. square, 5 ft. long, 2 ft. deep, marked 2-6190, for Cor. No. 2, and raised a mound of earth and stone around post.

A blazed hemlock tree, 8 ins. diam., marked B.T. 2-6191, bears S.48°15'W., 22 ft.

MS No. 6192 Pan Handle, Robert C. Williams, U.S. Deputy Mineral Surveyor, 1901  
Corner No. 4

600 S.W. location corner and Cor. No. 2 of Sur. No. 6191, a post, 4 1/2 ins. square, 5 ft. long, 2 ft. deep, marked 2-6191, I marked 4-6192, for Cor. No. 4 of this survey, there is a mound of earth and stone around post.

A blazed hemlock tree, 8 ins. diam., marked B.T. 4-6192, bears S.48°15'W., 22 ft.

## FOUND:

Found no remaining evidence of post, mound of stone, or the bearing tree.

## TO PERPETUATE:

At record position, set a 5/8" x 24" rebar, with a USFS 3-1/4" aluminum cap 20" in the ground, marked as shown below.



From which new trees:

A hemlock, 8" in diam., bears N.83°E., 21.0', blazed and scribed "4 MS 6192 BT".

A hemlock, 8" in diam., bears S.28°E., 6.6', blazed and scribed "2 MS 6191 BT"

Place a "Land Survey Monument" (54-9), and a "Bearing Tree" (54-3) sign on the bearing trees. Painted all blazes red, and a 6" red band above the "Bearing Tree" signs. Placed 6" steel posts on property line, 3'+/- from the corner with "Land Survey Marker" (54-9), and "Property Boundary" (54-2) decals

See Certificate of Survey, recorded in Lincoln County

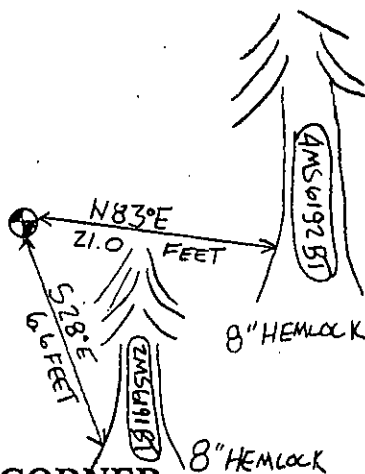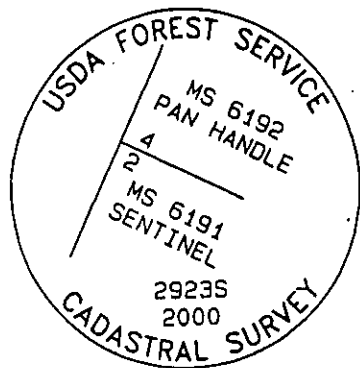

SKETCH OF CORNER

## CERTIFICATION

I, Matt Jacobson  
certify the information shown herein is true and correct.Matt Jacobson  
Signature Ground Party ChiefI, R.A. Ainsworth  
certify that this Corner Record correctly represents work performed by me or under my direction in compliance with the "Corner Recordation Act" (7Q-22-101, et seq., M.C.A.)R.A. Ainsworth  
Signature of Surveyor & SealDate: 11/00 Reg. No. 2923SEmployer: Professional Consultants, Inc.

Sec. 7

Office of Clerk and Recorder, County of Lincoln. This "corner record" was filed for record on Jan 10, 2001 10482 was noted on the cross-index plat and is assigned page No. 10482, in book No. Coral M. CumminsCounty Official Bob