

INSTRUCTIONS

Q:CO-STD/152
Created 4/8/92

1. Original and/or subsequent record used to evaluate the corner position.
2. Description of evidence found, note discrepancies in the record, state method of establishing lost or obliterated corners.
3. Description of monument and accessories set to perpetuate the corner position.
4. Sketch of corner, show all pertinent data which can best be shown in a sketch example, corner marking, topography ties, position of accessories,
5. Certification must be signed and sealed by Land Surveyor registered in the State of Montana.
6. Fill in Cross Index & Section Diagram at bottom of sheet.

CERTIFIED CORNER RECORDATION

Corner No. 2 Monarch MS 6185 & No. 4 Felicitas MS 6186 T. 25 N. R. 30 W. P.M.M. LINCOLN County

RECORD:

MS NO. 6185 Monarch, Robert C. Williams, U.S. Deputy Mineral Surveyor, 1901

Corner No. 2

1500 S.E. location corner, set a post, 4 1/2 ins. square, 5 ft. long, 2 ft. deep, marked 2-6185, for Cor. No. 2, and raised a mound of stone and earth around post.

A blazed fir, 8 ins. diam., marked B.T. 2-6185, bears S.8°W., 13 ft.

MS NO. 6186 Felicitas, Robert C. Williams, U.S. Deputy Mineral Surveyor, 1901

Corner No. 4

600 N.E. location corner, and Cor. No. 2 of Sur. No. 6185, set a post, 4 1/2 ins. square, 5 ft. long, 2 ft. deep, marked 2-6185, I marked it 4-6186 for Cor. No. 4 of this survey, there is a mound of stone and earth around post.

A blazed fir, 8 ins. diam., marked B.T. 4-6186, bears N.34°01'W., 18 ft.

FOUND:

Found no remaining evidence of the original post, mound of stone, or the bearing trees.

TO PERPETUATE:

At record position, set a 5/8" x 24" rebar, with a USFS 3-1/4" aluminum cap, 20" in the ground, marked as shown below, raise a mound of stone to cap.



From which new trees:

A hemlock, 12" in diam., bears N.58°E., 3.3', blazed and scribed "2 MS 6185 BT".

A larch, 10" in diam., bears S.30°E., 3.1', blazed and scribed "4 MS 6186 BT".

Place a "Land Survey Monument" (54-9), and a "Bearing Tree" (54-3) sign on the bearing trees. Painted all blazes red, and a 6" red band above the "Bearing Tree" signs. Placed 6' steel posts on property line, 5' +/- from the corner, with "Land Survey Marker" (54-9), and "Property Boundary" (54-2) decals.

See Certificate of Survey, recorded in Lincoln County

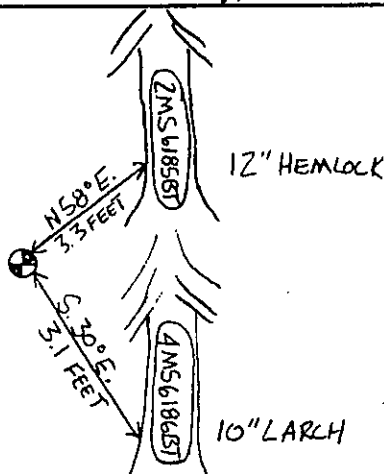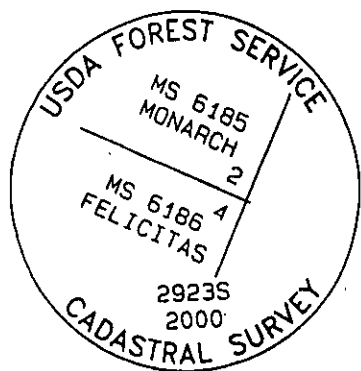

SKETCH OF CORNER

CERTIFICATION

I, Matt Jacobson
certify the information shown herein is true and correct.

Matt Jacobson
Signature Ground Party Chief

I, R.A. Ainsworth
certify that this Corner Record correctly represents work performed by me or under my direction in compliance with the "Corner Recordation Act" (70-22-101, et seq., M.C.A.)

R.A. Ainsworth
Signature of Surveyor & Seal

Date: 11/00 Reg. No. 29235

Employer: Professional Consultants, Inc.

Sec.17

Office of Clerk and Recorder, County of Lincoln. This "corner record" was filed for record on Jan 10, 2001 was noted on the cross-index plat and is assigned page No. 10491, in book No. Coral M. Cummings R/SB

County Official

