INSTRUCTIONS

1. Original and/or subsequent record used to evaluate the corner position.

2. Description of evidence found, note discrepancies in the record, state method of establishing lost or obliterated corners.

3. Description of monument and accessories set to perpetuate the corner position.

- 4. Sketch of corner, show all pertinent data which can best be shown in a sketch example, corner marking, topography ties, position of accessories,
- 5. Certification must be signed and sealed by Land Surveyor registered in the State of Montana.

CERTIFIED CORNER RECORDATION

Corner: Section Corner; Secs. 21, 22, 27 & 28

T. <u>26N.</u>

R. 28W. P.M.M. Lincoln County

1903 GLO Record:

Set sandstone and established 4 bearing trees.

1964 BLM Record:

Found stone and 2 original bearing trees.

Set iron post, 30" long, 2 1/2" dia., 27" in the ground, with brass cap, from which:

Original bearing trees:

A fir, 20" diam., bears N58 1/4°E, 12 lks (7.9'), mkd with an overgrown blaze

A fir, 21" diam., bears S39°W, 15 lks (9.9'), with overgrown blaze

New bearing trees:

A spruce, 13" diam., bears S32°E, 21 lks (13.9'), mkd T26N R28W S27 BT

A spruce, 11" fir, bears N74°W, 26 lks (17.2 ft.), mkd T26N R28W S21 BT

Buried the stone alongside.

2009 Found:

We find a standard BLM monument with a 3 1/4" BLM brass cap, 12" above the ground,

leaning and firmly set, marked as shown below, from which:

A 20" fir, bears N58 1/4°E, 7.9 ft., with partially overgrown blaze


A 21" fir bears S39°W 9.9 ft., with an overgrown blaze A 13" spruce bears S32°E 13.9 ft., with an overgrown blaze An 11" spruce bears N74°W 17.2 ft., with visible scribing

2009 Perpetuation:

We leave monument as found.

We set a galvanized steel with USFS decals P54-1 & P71-10, west of monument. We paint red bands on the bearing trees, and attached USFS signs 54-3 & 54-9 as needed.

SEE COS NO. 3991

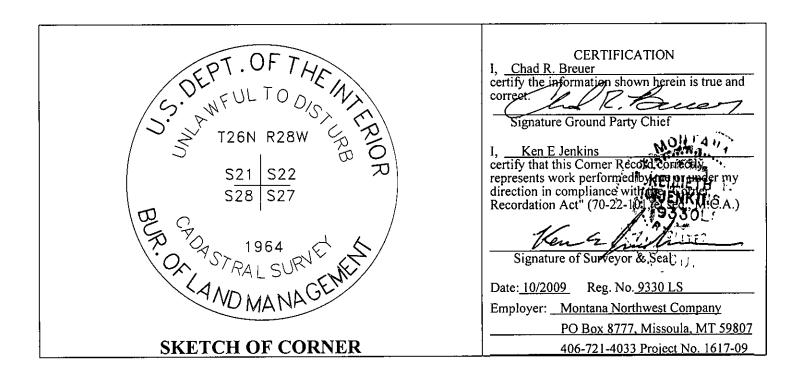

Sec. 28

Cross Index No. R-13 T. 26N R 28W PMM

Corner this sheet