INSTRUCTIONS



- 1. Original and/or subsequent record used to evaluate the corner position.
- 2. Description of evidence found, note discrepancies in the record, state method of establishing lost or obliterated corners.
- 3. Description of monument and accessories set to perpetuate the corner position.
- 4. Sketch of corner, show all pertinent data which can best be shown in a sketch example, corner marking, topography ties, position of accessories,
- 5. Certification must be signed and sealed by Land Surveyor registered in the State of Montana.

CERTIFIED CORNER RECORDATION

Corner: C-W-NW 1/64th; Sec. 28

T. 26N.

R. 28W. P.M.M. Lincoln County

Record:

No previous record

Found:

No evidence found

2009 Perpetuation:

At a position established by the survey and section breakdown of Section 28, we set a 5/8"x30" rebar, 28" in the ground affixed with a 3 1/4" U.S.F.S. alum cap, marked as shown below.

From the monument, we establish the following reference monuments:


A 6" spruce, bears S12°W, 25.3 ft., with an "X" cut at breast height A 5" Subalpine fir, bears S69°E, 7.8 ft., scribed CWNW 1/64 S28 BT

We build a mound of stone around the monument.

We set galvanized steel posts with USFS decals P54-1 & P71-10, south, 1.5 ft. and east, 1.4 ft. of the monument.

We paint red bands on the bearing trees and attach USFS signs 54-3 & 54-9.

SEE COS NO. 3991

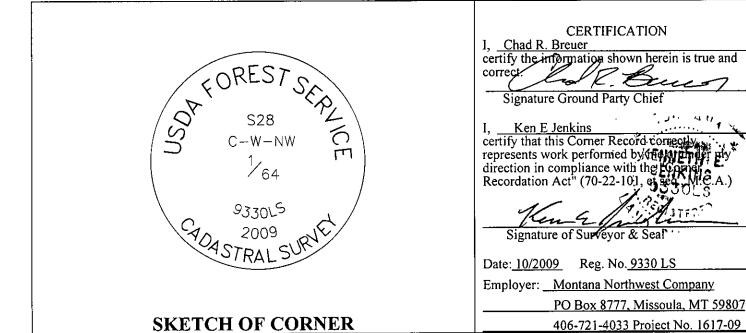

_____. This "corner Office of Clerk and Recorder, County of ____ record" was filed for record or PAGE: 11453 Pages: 1 224827 BOOK: CCR CC&R'S was noted on the cross-index STATE OF MONTANA LINCOLN COUNTY RECORDED: 03/05/2010 8:56 KOI: CC&R'S book No. _ TAMMY D. LAUER CLERK AND RECORDER BY Seas FEE: \$0.00 TO: MONTANA NORTHWEST COMPANY P.O. BOX 8777, MISSOULA, MONTANA

Cross Index No.

<u>S-9.5</u> T. <u>26N</u> R<u>28W</u> PMM

Corner this sheet

Sec. 28

406-721-4033 Project No. 1617-09