INSTRUCTIONS

- 1. Original and/or subsequent record used to evaluate the corner position.
- 2. Description of evidence found, note discrepancies in the record, state method of establishing lost or obliterated corners.
- 3. Description of monument and accessories set to perpetuate the corner position.
- 4. Sketch of corner, show all pertinent data which can best be shown in a sketch example, corner marking, topography ties, position of
- 5. Certification must be signed and sealed by Land Surveyor registered in the State of Montana.

CERTIFIED CORNER RECORDATION

Corner: Section Corner; Secs. 28,29,32&33

T. 26N.

R. 28W. P.M.M. Lincoln County

1903 GLO Record:

Set 3 ft. fir post. Established 4 bearing trees

1964 BLM Record:

Set an iron post, 30 ins. long, 2 ½" diam., 28 ins. in the ground, with brass cap, from

Original bearing trees:

An aspen, 16 ins. diam., bears S04 1/2°E, 247 lks (163.0 ft.), with illegible

scribing

An aspen, 16 ins. diam., bears \$16 1/4°W, 143 lks (94.4 ft.), with illegible

scribing

Corner is 27 lks (17.8 ft.), N. of fence intersection extending E, SE & W.

1985 Record:

(Hill)

Found a BLM monument, flush with ground, with a brass cap marked as described in the

BLM record, from which the following references: An aspen snag, bears S18°W, 143.6 lks (94.8 ft.), scribing visible

An aspen blow down, bears \$02°W, 242.4 lks (160.0 ft.), scribing visible

A fence corner post, bears East, 1.0 ft. A fence corner post, bears S02°W, 17.9 ft.

New bearing tree

An aspen ,13 ins. diam., bears S48°W, 108.2 lks (71.4 ft.) marked T26N R28W

S32 BT

Set guard post 2.0 ft. south from corner

2009 Found:

We find a standard BLM monument with a 3 1/4" BLM brass cap, firmly set, in good condition, set flush with the ground, in E-W fence line, marked as shown below, from which:

An 18" aspen, bears S48°W, 71.4 ft., with scribing visible, and a 1985 BT tag marked "N48°W 71.4""

An 8" fence post, bears East 1.2 ft.

Decayed tree remains, bears S18°W, 94.8 ft. Decayed tree remains, bears S5°E, 16.3 ft., w/ blank BT tag


From the found monument we establish the following reference monuments: 2009 Perpetuation: An 8" wood fence post, bears East, 1.2 ft.

A 14" aspen, bears \$04°E, 152.0 ft., scribed T26N R28W S33 BT

We posted USFS decals P54-1 & P71-10 on steel post, 1.8 ft. south of monument.

We paint red bands on the existing & new bearing tree, and attached USFS signs 54-3 & 54-9.

SEE COS NO. 3991

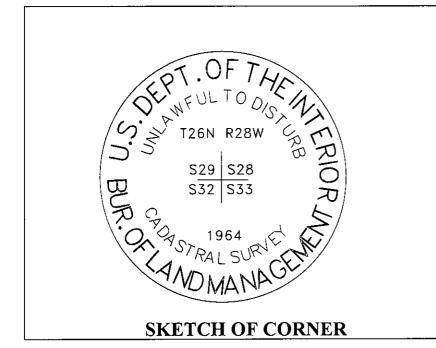

CERTIFICATION Chad R **Breuer** certify the information shown herein is true and correct. . 7 Signature Ground Party Chief Ken E Jenkins certify that this Comer Record corresponds work performed by me on the represents work performed by me on the represents work performed by me on the representation in compliance with the representation of the record of the representation of the record of certify that this Corner Record correctly Signature of Surveyor & Seal S 113 Reg. No. 9330 LS Date: 8/2009 Employer: Montana Northwest Company PO Box 8777, Missoula, MT 59807

406-721-4033 Project No. 1617-09

This "corner Office of Clerk and Recorder, County of PAGE: 11459 Pages: 1 224833 BOOK: CCR CCER'S record" was filed for record STATE OF MONTANA LINCOLN COUNTY was noted on the cross-ind RECORDED: 03/05/2010 9:02 KOI: CCGR'S TAMMY D. LAUER CLERK AND RECORDER book No. FEE: \$0.00 BY: P.O. BOX 8777, MISSOULA, MONTANA TO: MONTANA NORTHWEST COMPANY

Sec. 28