

1. Original and/or subsequent record used to evaluate the corner position.
2. Description of evidence found, note discrepancies in the record, state method of establishing lost or obliterated corners.
3. Description of monument and accessories set to perpetuate the corner position.
4. Sketch of corner, show all pertinent data which can best be shown in a sketch example, corner marking, topography ties, position of accessories,
5. Certification must be signed and sealed by Land Surveyor registered in the State of Montana.

**CERTIFIED CORNER RECORDATION**Corner: 1/4 Corner; Secs. 13 & 14T. 26N.R. 29W. P.M.M. Lincoln County

1903 GLO Record: Set limestone. Established 2 BTs.


1964 BLM Record: Found orig. stone, firmly set and the remains of the 2 BTs.  
At the corner point, set iron post, 30" long, 2 1/2" dia., 27" in the ground, with brass cap.  
Original bearing trees:  
A stumphole, bears N34°E, 44 lks (29.0 ft.) (GLO Record - N34°10'E, 44 lks)  
An 18" pine, bears S33°W, 62 lks (40.9 ft.), mrk'd 1/4 S14BT (GLO Record - S33°W, 77 lks)  
New bearing tree:  
A 6" fir, bears N55°E, 24 lks (15.8 ft.), marked 1/4 S13 BT

1985 Record: Found BLM monument., rising 4" above the ground, with brass cap  
(Hill) A Stump hole, bears N42°E, 44.4 lks (29.3 ft.)  
An 8" fir, bears N54°E, 23.9 lks (15.8 ft.), with partially visible scribing  
A 5" fir, bears S25°E, 4.8 lks (3.2 ft.), with St. Regis location poster  
New references:  
An 8" larch, bears N70°W, 35.6 lks (23.5 ft.), scribed 1/4 S14 BT  
Set guard post, 3.0 ft., east from corner

2009 Found: We find a standard BLM monument. with a 3 1/4" brass cap, firmly set, in good condition, 6" above the ground The cap was stamped as shown below, from which:  
A 10" Douglas fir, bears N54°E, 15.8 ft., with overgrown blaze & BT tags  
An 11" Lodgepole pine, bears S77°W, 5.5 ft., with U.S.F.S. location poster, no BT tag  
An 11" larch, bears N70°W, 23.5 ft., with overgrown blaze & BT tag  
An 8" Douglas fir, bears S30°E, 3.2 ft., with St. Regis location poster, no BT tag  
Found post 3.0 ft. east of corner

2009 Perpetuation: We paint red bands on the new bearing trees, and attached USFS signs 54-3 &amp; 54-9.

SEE COS NO. 3990

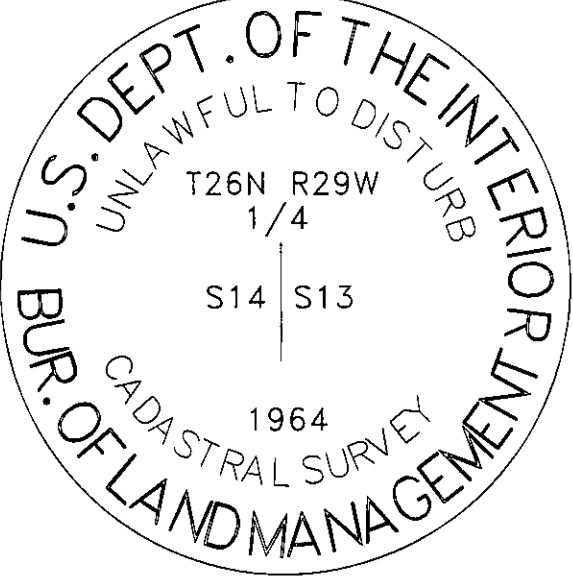 <b>SKETCH OF CORNER</b>	<p><b>CERTIFICATION</b> I, <u>Chad R. Breuer</u> certify the information shown herein is true and correct. <i>Chad R. Breuer</i> Signature Ground Party Chief</p> <p>I, <u>Ken E Jenkins</u> certify that this Corner Record correctly represents work performed by me or under my direction in compliance with the Corner Recordation Act" (70-22-101, et seq., M.C.A.) <i>Ken E Jenkins</i> Signature of Surveyor</p> <p>Date: <u>9/2009</u> Reg. No. <u>9330 LS</u> Employer: <u>Montana Northwest Company</u> <u>PO Box 8777, Missoula, MT 59807</u> <u>406-721-4033 Project No. 1617-09</u></p>
--	--

Office of Clerk and Recorder, County of \_\_\_\_\_, This "corner

record" was filed for record on \_\_\_\_\_

was noted on the cross-index plat at \_\_\_\_\_

book No. \_\_\_\_\_

224844 BOOK: CCR CC&amp;R'S PAGE: 11470 Pages: 1

STATE OF MONTANA LINCOLN COUNTY

RECORDED: 03/05/2010 9:12 KOI: CC&amp;R'S

TAMMY D. LAUER CLERK AND RECORDER


FEE: \$0.00

TO: MONTANA NORTHWEST COMPANY P.O. BOX 8777, MISSOULA, MONTANA

Cross Index No.

L-21 T. 26N R. 29W PMM

Sec. 14

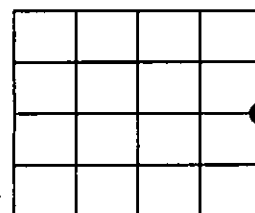

● Corner this sheet