## INSTRUCTIONS

- 1. Original and/or subsequent record used to evaluate the corner position.
- 2. Description of evidence found, note discrepancies in the record, state method of establishing lost or obliterated corners.
- 3. Description of monument and accessories set to perpetuate the corner position.
- 4. Sketch of corner, show all pertinent data which can best be shown in a sketch example, corner marking, topography ties, position of accessories
- 5. Certification must be signed and sealed by Land Surveyor registered in the State of Montana.

## **CERTIFIED CORNER RECORDATION**

Corner: C-S-NW-NW 1/256th; Sec. 34

T. 26N.

R. 29W. P.M.M. Lincoln County

Record:

No previous record

Found:

No evidence found

2009 Perpetuation:

At a position established by the survey and section breakdown of Section 34, we set a 5/8"x30" rebar, 26" in the ground affixed with a 3-1/4" U.S.F.S. alum cap, marked as shown below, from which we establish the following reference monuments:


An 11" Tamarack, bears N69°W, 24.0 ft., scribed CSNWNW 1/256 S34 BT A 14" Tamarack, bears N12°W, 28.4 ft., with an "X" cut at breast height

We build a mound of stone around the monument.

We set galvanized steel posts with U.S.F.S. decals P54-1 and P71-10, 0.6 ft., north and 0.6 ft., west of the monument.

We paint red bands on the bearing trees and attach USFS signs 54-3 & 54-9.

SEE COS NO. 3992

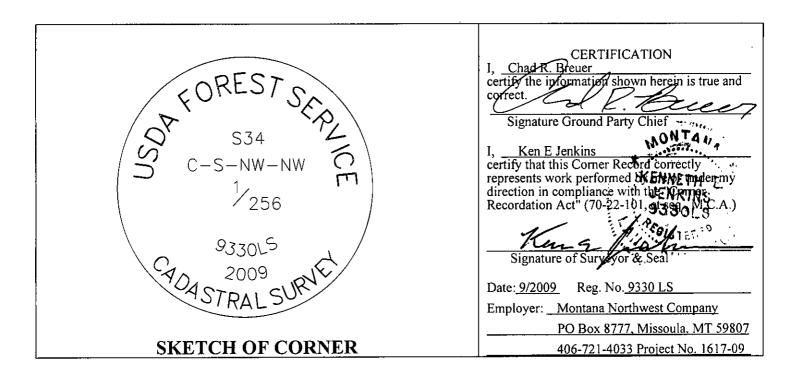

	,	Sec. 34		
Office of Clerk and Recorder, County of This "corner	•			
record" was filed for record on 224859 BOOK: CCR CCER'S PAGE: 11485 Pages: 1				
was noted on the cross-index pl STATE OF MONTANA LINCOLN COUNTY  BOOK No.  RECORDED: 03/05/2010 9:27 KOI: CCGR'S	_			
TAMMY D. LAUER CLERK AND BECORDER  FEE: \$0.00 BY:  TO: MONTANA NORTHWEST COMPANY P.O. BOX 8777, MISSOULA, MONTANA				

Cross Index No. <u>V.75-13.5</u> T. <u>26N</u> R <u>29W</u> PMM

Corner this sheet