

1. Original and/or subsequent record used to evaluate the corner position.
2. Description of evidence found, note discrepancies in the record, state method of establishing lost or obliterated corners.
3. Description of monument and accessories set to perpetuate the corner position.
4. Sketch of corner, show all pertinent data which can best be shown in a sketch example, corner marking, topography ties, position of accessories,
5. Certification must be signed and sealed by Land Surveyor registered in the State of Montana.

CERTIFIED CORNER RECORDATION

Corner: 1/4 Corner, Secs. 3 & 34 T. 25N. & 26N. R. 29W. P.M.M. Lincoln County

1903 GLO Record: Set limestone and established 2 bearing trees.

1978 BLM Record: Found orig. stone, firmly set & marked w/ 1/4 on N. face and remains of original bearing trees.
A 24" stump, bears S75 1/2°W, 110 lks (72.6 ft.)
A 42" pine snag, bears N36°10'W, 68 lks (44.9 ft.), mk'd 1/4 S34 BT (GLO Record 57 lks)

Set an iron post 30" long, 2 1/2" diam., 22" in the ground, with brass cap. Buried orig. stone alongside.

New bearing trees:

An 8" fir, bears S64°W, 22 lks (14.5 ft.), marked 1/4 S3 BT

An 8" fir, bears N41°W, 21 lks (13.9 ft.), marked 1/4 S34 BT

2006 Record: Found 3 1/4" brass cap on 2 1/2" iron pipe, 7" above the ground. From which:
(Staples) A 42" dead, standing, Ponderosa pine, bears N36 1/4°W, 45.86 feet distant, scribed 1/4 S34 BT
A 15" dead, standing, Douglas fir, bears N44 1/4°W, 13.88 ft., marked with a BT tag & scribed 1/4 S34 BT
A 15" Douglas fir, healed scribe wound, bears S62 3/4°W, 14.67 ft

New bearing tree:

An 18" Douglas fir, bears N21°W, 42.89 ft., scribed 1/4 S34 BT & BT tag

2009 Found: We find a standard BLM monument with a 3 1/4" brass cap, firmly set, in good condition, rising 6" above the ground, marked as shown below, from which:

A 15" Douglas fir, bears S63 3/4°W, 14.7 ft., with an overgrown blaze


A 15" Douglas fir snag, bears N44 1/4°W, 13.9 ft., with scribing visible

A 32" Ponderosa pine snag, bears N36 1/4°W, 45.9 ft., with scribing visible

A 14" Douglas fir, bears N21°W, 42.9 ft., with scribing visible

A galvanized steel post, bears West, 1.5 ft.

2009 Perpetuation: We establish no new reference monuments
We attached new P54-1 & P71-10 signs on steel post.
We paint red bands on the existing bearing trees, and attached USFS signs 54-3 & 54-9.
SEE COS NO. 3992

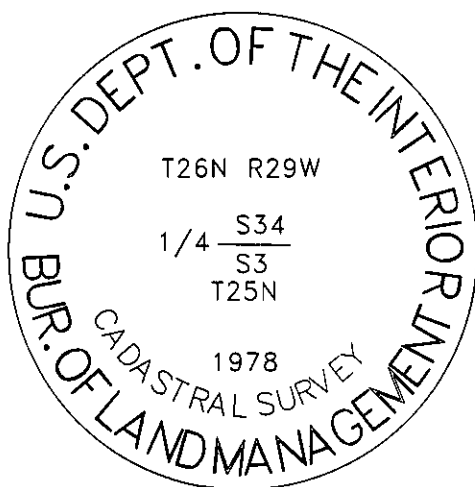

SKETCH OF CORNER

CERTIFICATION

I, Chad R. Breuer
certify the information shown herein is true and correct.

Chad R. Breuer
Signature Ground Party Chief

I, Ken E Jenkins
certify that this Corner Record correctly represents work performed by me or under my direction in compliance with the "Corner Recordation Act" (70-22-101, MCA).

Ken E Jenkins
Signature of Surveyor, Seal

Date: 8/2009 Reg. No. 9330 LS

Employer: Montana Northwest Company
PO Box 8777, Missoula, MT 59807
406-721-4033 Project No. 1617-09

Sec. 34

Office of Clerk and Recorder, County of _____ This "corner


record" was filed for record on

was noted on the cross-index

book No. _____

224871 BOOK: CCR CC&R'S PAGE: 11497 Pages: 1
STATE OF MONTANA LINCOLN COUNTY
RECORDED: 03/05/2010 9:39 KOI: CC&R'S
TAMMY D. LAUER CLERK AND RECORDER
FEE: \$0.00 BY: *Tammy D. Lauer*
TO: MONTANA NORTHWEST COMPANY P.O. BOX 8777, MISSOULA, MONTANA

Cross Index No. Z-15 T. 26N R 29W PMM

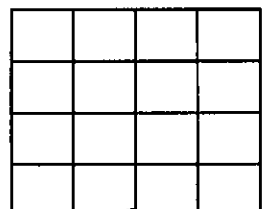

● Corner this sheet