

INSTRUCTIONS

1. Original and/or subsequent record used to evaluate the corner position.
2. Description of evidence found, note discrepancies in the record, state method of establishing lost or obliterated corners.
3. Description of monument and accessories set to perpetuate the corner position.
4. Sketch of corner, show all pertinent data which can best be shown in a sketch example, corner marking, topography ties, position of accessories, etc.
5. Certification must be signed and sealed by Registered Land Surveyor in State of Montana.
6. Fill in Cross Index & Section Diagram at bottom of sheet


**CERTIFIED CORNER RECORDATION**

Corner 1/4 S9 | S10 T. 26N R. 29W P.M.M. Lincoln County

Date of Work: Sept. 28th, 1982

1. (A) 1903 - B.L.M. Original Record; Set a fir post, 3 ft. long, 3 ins. sq., 24 ins. in the ground for 1/4 Sec. Cor., marked 1/4 S9 on W. face, 10 on E. face; from which:
  - A Pine, 10 ins. diam., bears N38°15'E, 35 lks. dist., marked 1/4 S10BT.
  - A Tamarack, 10 ins. diam., bears S68°W, 20 lks. dist., marked 1/4 S9BT.
- (B) 1964 - B.L.M. record; found a disintegrated wooden post, firmly set in the ground, and witnessed by the remains of the original bearing trees. At the corner point; set an iron post, 30 ins. long, 2 1/2 ins. diam., 27 ins. in the ground, with brass cap marked as shown below; from which:
  - The remains of the original bearing trees:
    - A stump, 13 ins. diam., bears N38 1/4°E, 35 lks. dist., visible marks BT. (Record)
    - A Larch, 14 ins. diam., bears S68°W, 20 lks. dist., marked with an overgrown blaze. (Record)
  - The new bearing tree:
    - A Spruce, 9 ins. diam., bears N24 1/2°E, 35 lks. dist., mkd. 1/4 S10BT.
  - Bury the remains of the original wooden post alongside of the iron post.
2. 1982 - Found a 2 1/2" iron post approx. 8 ins. above ground with B.L.M. brass cap marked as shown below; from which:
  - A stump, 13 ins. diam., bears N38 1/4°E, 35 lks. dist., visible marks BT. (Record)
  - A Larch, 14 ins. diam., bears S68°W, 20 lks. dist., marked with a partially opened overgrown blaze, visible marks 9. (Record)
  - A Spruce, 9 ins. diam., bears N24 1/2°E, 31 lks. dist., marked 1/4 S10BT with pitch over blaze overgrowing. (Record)

Posted by: BLM/USFS      Date: 1964
3. No additional accessories set to perpetuate monument.

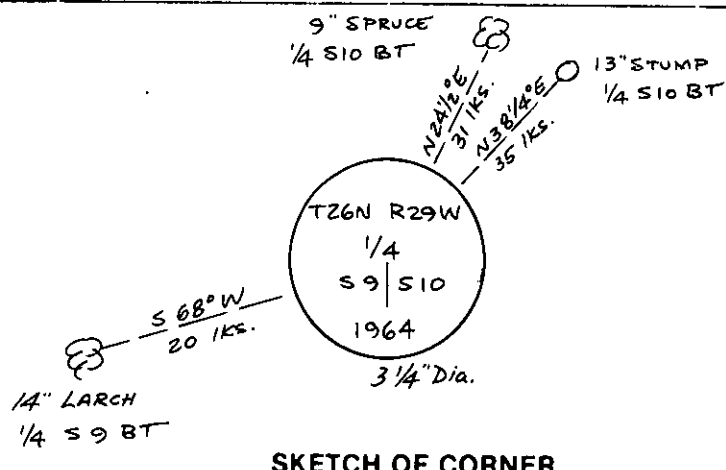

SKETCH OF CORNER

CERTIFICATION

L. A. Dolezal  
 certify the information shown herein is true and correct  
*L. A. Dolezal*  
 Signature of Party Chief


Melvin D. Lauteren  
 certify that this Corner Record correctly represents work performed by me or under my direction in compliance with the Corner Recordation Act (70-22-101 MCA)  
*Melvin D. Lauteren*  
 Signature of Surveyor & Seal

Date: 10/15/82 Reg. No. 4232 S

Employer: KOOTENAI ENGINEERING, INC.

Office of Clerk and Recorder, County of LINCOLN. This "corner record" Sec. 9-T26N-R29W-PMM  
 was filed for record on the 15 day of OCT 1982, was noted on the cross-index plat and  
 is assigned page No. 1965, in book No. Eleanor L. Vaughn by Betty L. Conco  
 County Official deputy

Cross Index No. 26 R. 29 P.M.M.

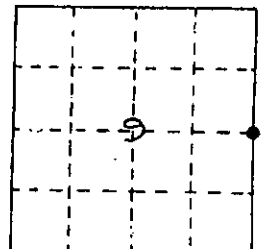

• corner this sheet