

CERTIFIED LAND CORNER RECORDATION

SECTION 10 TWP. 26 N., R. 29 W., M.P.M.

DESCRIPTION OF CORNER EVIDENCE FOUND, AND ORIGINAL RECORD (IF KNOWN)

5 Corners used in this survey are brass cap monuments set by B.L.M. See diagram on other side.

DESCRIPTION OF MONUMENT AND ACCESSORIES ESTABLISHED TO PERPETUATE THE ORIGINAL LOCATION OF THIS CORNER:

June 30 to

Date of work: July 9, 1971

11 Corners established by this survey -

See descriptions and diagram on other side.

SKETCH, WITH COURSE AND DISTANCE TO ADJACENT CORNERS IF DETERMINED IN THIS SURVEY. (MAY SKETCH OR PASTE REPRODUCTION ON REVERSE SIDE.)

See diagram on other side.

Surveyor's Seal


I, Jack H. Ninneman certify that the information shown herein is true and correct.

Signature of Ground Party Chief

Jack W. Ninneman I, certify that I have carefully performed or reviewed the work done on the diagrammed corner as reported on this recordation form and approve the same.

Signature of Surveyor

DIAGRAM OF CORNER: Sec. 10

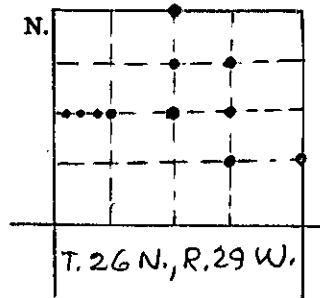

● = Corner recorded on the sheet

534 E.S. Registration Number

Office of Clerk and Recorder, County of Lincoln

This "corner record" was filed for record on the 28th day of July 1971, was noted on the cross-index plat and is assigned page No. 233, in book No. 1

Signature of County Official: Eleanor L. Vaughan by Betty Stonebocker, Deputy

Cross Index No. G. 141516 T. 26 R. 29

SECTION 10 TWP. 26 N., R. 29 W., M. P. M.

- 1, 2, 3, 4, 5, Brass cap monuments by B.L.M.
- 6, 7, 8, Steel pipes by Ninneman Engineering with location posters
- 9, Brass cap monument by Ninneman Engineering with location posters.
- 10, Brass cap monument by Ninneman Engineering from which
A 10" Fir bears N 1° E 19.9 feet - A 36" pine bears S 88° 40' E 4.0 feet
Both scribed and posted.
11. Brass cap monument by Ninneman Engineering from which
A 24" Larch bears N 5° W 47.1 feet - A 20" Pine bears S 16° W 37.9 feet
Both scribed and posted.
12. Brass cap monument by Ninneman Engineering from which
A 8" Pine bears N 63° E 15 feet - A 12" Fir bears S 64° W 15 feet.
Both scribed and posted
13. Brass cap monument by Ninneman Engineering from which -
A 20" Larch bears N 72° E 19 feet - A 16" Fir bears S 8° E 18.0 feet.
Both scribed and posted.
14. Brass cap monument by Ninneman Engineering from which
A 14" Pine bears S 85° 16' W 32.0 feet - An 8" Larch bears S 52° 43' E 16.7 feet.
Both scribed and posted.
15. Brass cap monument by Ninneman Engineering from which
A 12" Fir bears S 12° 36' W 91.0 feet - A 30" Fir bears S 52° 11' E 52.0 feet.
Both scribed and posted.
16. Brass cap monument by Ninneman Engineering from which
A 24" Spruce bears N 82° 25' W 35.3 feet - A 12" Larch bears N 11° 25' E 20.6 feet.
Both scribed and posted
A boat spike in centerline of U. S. Highway No. 2 bears S 0° 30' 49" W 37.21 feet -
on north-south centerline of Section 10 Twp. 26 N., R. 29 W., M.P.M.

