



-CERTIFIED CORNER RECORDATION


Corner	1/4	Secs.	1&2	T.	27N	R.	30W	P.M., MT	Lincoln	County

I. 1900 G.L.O. Record by Burton S. Adams: Set a limestone, 26x12x3 ins., 20 ins. in the ground, for 1/4 sec. cor., mkd. "1/4" on W. face.

Established two bearing trees:

A fir, 8 ins. diam., bears N81°15'E, 33 lks. dist., mkd. "1/4 S1 BT". A pine, 8 ins. diam., bears S61°W, 69 lks. dist., mkd. "1/4 S2 BT".

1969 B.L.M. Remonumentation Record by Roy G. Leedy: The 1/4 sec. cor. of secs. 1 & 2, monumented with a broken limestone, firmly set, mkd. "1/4" on the W. face, and witnessed by the remains of the original bearing trees. At the corner point, set an iron post, 30 ins. long, 2 1/2 ins. diam., 24 ins. in the ground, with brass cap mkd. as shown.

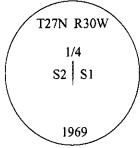

Established two new bearing tree and bury the original stone alongside and raise a collar of stone, 2.0 ft. diam., around the iron post.

II. Found a 2 1/2 in. diam. iron pipe, firmly set, protruding 7 ins. above the ground, with a collar of stone surrounding the 3 1/4 in. diam. B.L.M. brass cap, mkd. as shown.

from which:

A pine, 13 ins. diam., bears S89°E, 40.3 ft.. dist., with a healed face. (BLM-record)

A rotten pine stump, bears S61°W, 45.5 ft. dist., with visible scribe. (GLO-record)


A fir, 10 ins. diam., bears N70°W, 13.9 ft. dist., with a healed face. (BLM-record)

A steel post, with Property Boundary and Land Survey Monument decals attached.

III. Set a 6 ft. galvanized steel guard post, North, 3.0 ft. dist. of the corner, with Property Boundary and Land Survey Monuement decals attached.

Painted bearing trees and attached Land Survey Monument and Bearing Tree signs.

Magnetic Declination: 20° East

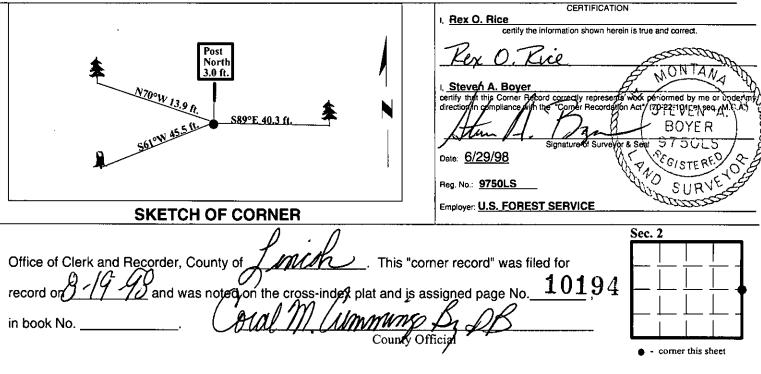

30W