

-CERTIFIED CORNER RECORDATION


Corner **Sec. Cor.** **Secs.** **2,3,10,11** **T.** **27N** **R.** **30W** **P.M., MT** **Lincoln** **County**

I. 1900 G.L.O. Record by Burton S. Adams: Set a sand stone, 10x10x4 ins., 15 ins. in the ground, for cor. of secs. 2,3,10 and 11, mkd. with 5 notches on S. and 2 notches on E. edges.

Established four bearing trees:

- A spruce, 6 ins. diam., bears N52°15'E, 47 lks. dist., mkd. "T27N R30W S2 BT".
- A hemlock, 8 ins. diam., bears S63°45'E, 35 lks. dist., mkd. "T27N R30W S11 BT".
- A hemlock, 8 ins. diam., bears S34°W, 45 lks. dist., mkd. "T27N R30W S10 BT".
- A hemlock, 10 ins. diam., bears N65°45'W, 25 lks. dist., mkd. "T27N R30W S3 BT".

1966 B.L.M. Remonumentation Record by Roy G. Leedy: The cor. of secs. 2,3,10 & 11, monumented with a limestone, 20x12x6 ins., firmly set, mkd. with 5 notches on the S. and 2 notches on the E. edges, and witnessed by the original bearing trees. At the corner point, set an iron post, 30 ins. long, 2 1/2 ins. diam, 24 ins. in the ground with brass cap mkd. as shown.

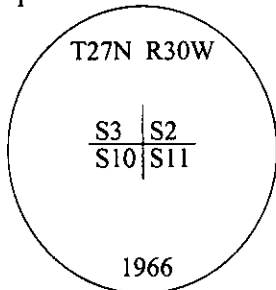

Established one new bearing tree and bury the original stone alongside the iron post.

II. Found a 2 1/2 in. diam. iron pipe, protruding 6 ins. above the ground, tilted out of position, by a fallen tree, with a 3 1/4 in. diam. B.L.M. brass cap, mkd. as shown.

from which:

- A high spruce stump, 14 ins. diam., bears N14°E, 33.8 ft. dist., with visible scribe. (BLM-rec)
- A hemlock, 16 ins. diam., bears S64°E, 23.7 ft. dist., with a healed face. (GLO-record)
- A high hemlock stump, 20 ins. diam., bears S34°W, 29.7 ft. dist., with a healed face. (GLO-rec)
- A hemlock, 17 ins. diam., bears N66°W, 17.1 ft. dist., with a healed face. (GLO-record)
- A steel guard post, East, 3.0 ft. dist. of the corner, with Property Boundary and Land Survey Monument decals attached.

III. At a distance-distance intersect from the found bearing trees, reset the B.L.M. iron pipe, 25 ins. in the ground, brass cap mkd. as shown.


Established one new bearing tree:

A hemlock, 9 ins. diam., bears N76°E, 38.3 ft. dist., mkd. "T27N R30W S2 BT".

No trees available in sec. 10, due to logging.

Painted bearing trees and attached Land Survey Monument and Bearing Tree signs.

Magnetic Declination: 20° East

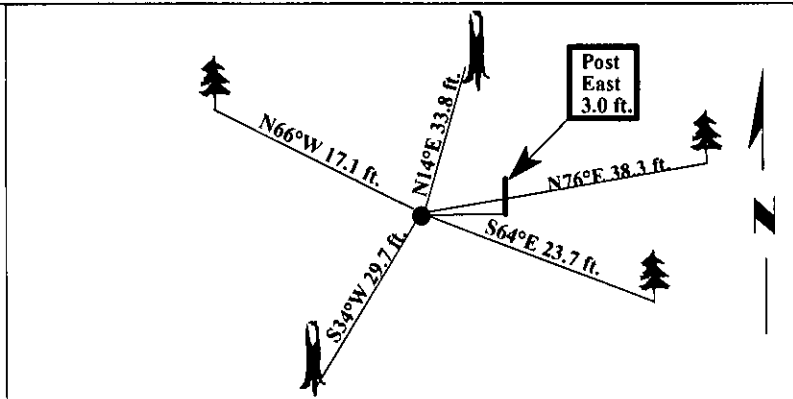

SKETCH OF CORNER

CERTIFICATION

I, Rex O. Rice
certify the information shown herein is true and correct.

Rex O. Rice

I, Steven A. Boyer
certify that this Corner Record correctly reflects work performed by me or under my direction in compliance with the Corner Recordation Act (70-22-101, et seq., M.C.A.)

Steven A. Boyer
Signature of Surveyor

Date: 6/23/98

Reg. No.: 9750LS

Employer: U.S. FOREST SERVICE

Office of Clerk and Recorder, County of Lincoln. This "corner record" was filed for record on 6-6-98 and was noted on the cross-index plat and is assigned page No. 10219 in book No. _____

Carol M. Cummings
 County Official

Sec. 2

● - corner this sheet