
## CERTIFIED CORNER RECORDATION

Corner SE-SE-NW 1/256 S2 T 27 N. R. 30 W . P.M.M. LINCOLN County

- I. Record: No previous survey.
- II. Found: No evidence found.
- III. At the corner point

  Set an iron rebar, 24 ins. long, 5/8 ins. diam., 26 ins. in the ground, with a 3 1/4 ins. diam., aluminum U.S.F.S cap mkd. as shown:

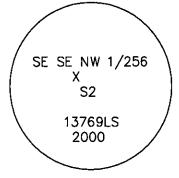

From which:

A fir, 18 ins. diam., bears N44'W, 94.2 ft. dist., mkd. SESENW 1/256 BT. A fir, 22 ins. diam., bears N76'W, 87.2 ft. dist., mkd. "X" BT.


Set 2, 4 in. x 4 in. wood posts, 3 ft. north and west of the corner, with Property Boundary and Land Survey Monument signs attached. Painted red bands around BT's and attached Bearing Tree and Land Survey Monument signs.

Survey crew: Steve Boyer, Tom Hommel

Magnetic declination: 20° East assumed


Equipment used: Hand compass and loggers tape

U. S. Forest Service, Supervisiors Office, 1101 Hwy. 2 West, Libby, MT. 59923 (406)

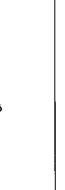

SKETCH OF CORNER

NOT TO SCALE

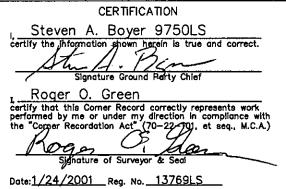


Employer: U. S. Forest Service

Office of Clerk and Recorder, County of Lincoln This "corner record" was filed for record on 35, 20/
was noted on the cross-index plat and is assigned page No. 10502 in book No.

County Official

Cross Index No. <u>B.75-18.75</u> T. <u>27N. R.</u> <u>30W.</u> P.M., MT

Adopted July 1, 1981, Montana Board of Professional Engineers & Land Surveyors

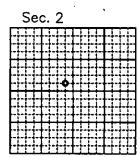

MONTANA

ROGÉR O GRÉÉN.

13769LS

· comer this sheet