- Description of evidence found, note discrepancies in the record, state method of establishing lost or obliterated corners.
- Description of monument and accessories set to perpetuate the corner position. Sketch of corner, show all pertinent data which can best be shown in a sketch example. inple, corner marking, topography ties, position of accessories, etc.
- Certification must be signed and scaled by Registered Land Surveyor in State of Montana.
- Fill in Cross Index & Section Diagram at bottom of sheet.

CERTIFIED CORNER RECORDATION 5 1/16th

Corner Section 22 + Section 23 T. 27N., R. 30W., P.M.M. Lincoln County

Date of Work: 9/15/83


- <u>l</u>. No previous record.
- 2. No evidence found.
- Set a 2 1/2 inch diam. X 30 inch long Aluminum Post with lower half Э. crimped and with a 3 1/2 inch diam. Aluminum Cap marked as shown below in sketch of corner; set 6 to 9 inches, more or less, above ground with small dirt mound around corner; no rock readily available; corner painted red with blue flagging tied around it.

From which:

- A Lodgepole Pine, 10 inches in diam., bears S. 13 1/20 W., 22.1 feet distant, marked: S 1/16 S22 BT
- A Lodgepole Pine, A inches in diam., bears N. 82° E., 16.2 feet distant, marked: \$ 1/16 \$23 BT

Bearing trees tagged with U.S.F.S. interior location posters; with faces of scribed blazes and snow blazes painted red and red ring painted above tags.

NOTE: Corner falls on gentle slope in the bottom of the main drainage of Miller Creek approximately 300-310 feet South of the main Miller Creek Road, North of Miller Creek.

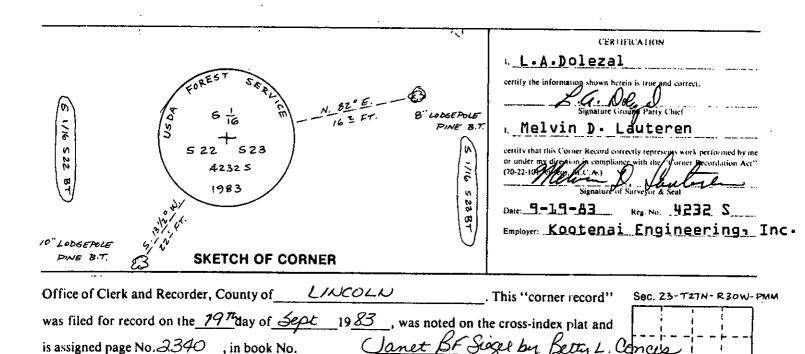

County Official

corner this sheet

Gep

r. 27 r. 30 PMM