## -CERTIFIED CORNER RECORDATION

Lincoln 28N 27 1/2W 11,12,13,14 R. P.M., MT County Corner Sec. Cor. Secs.

- I. 1902 G.L.O. Record by Burton S. Adams et.al.: Set a limestone, 15x10x8 ins., 10 ins. in the ground for the cor. of secs. 11,12,13,14, mkd. with 4 notches on S. and 1 notch on E. edges. Established four bearing trees.
- II. Found stone, 15x10x8 ins. diam., lying on the surface of the ground, approximately 30.0 ft. from determined corner position, mkd. with 4 notches on S. and 1 notch on the E. edges.

from which:


A larch, 25 ins. diam., bears N64°E, 33.0 ft. dist., with visible scribing. (record)

A larch, 25 ins. diam., bears \$14°E, 28.5 ft. dist., with visible scribing. (record-\$23°30'E,38 lks.,25.08 ft.)

A larch, 31 ins. diam., bears S52°W, 42.9 ft. dist., with a healed face. (record)


A larch, 26 ins. diam., bears N45°W, 52.1 ft. dist., with a healed face. (record)

At the exact corner position, as determined by using distance-distance intersect, from found original III. G.L.O. bearing trees, set a 2 1/2 in. diam., 30 ins. long aluminum pipe, 26 ins. in the ground, with a 3 1/4 in. diam. aluminum cap, mkd. as shown.

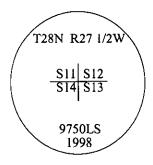

Painted bearing trees and attached Land Survey Monument and Bearing Tree signs.

Magnetic Declination: 20° East

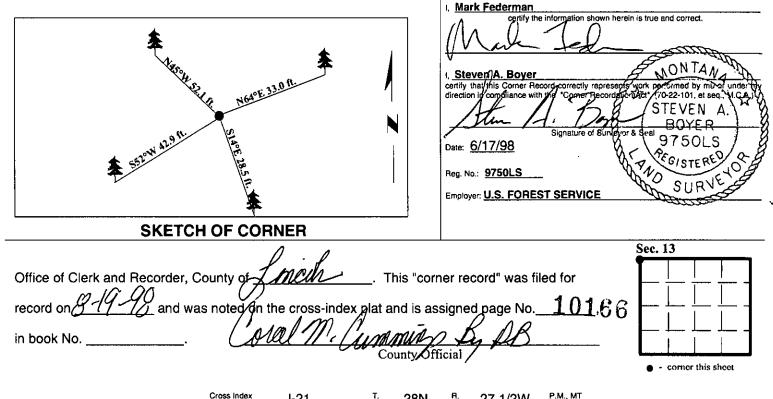

CERTIFICATION