Original and/or subsequent record used to evaluate the corner position.

Description of evidence found, note discrepancies in the record, state method of establishing lost or obliterated corners.

- Description of monument and accessories set to perpetuate the corner position.
   Sketch or corner, show all pertinent data which can best be shown in a sketch example, corner marking, topography ties, position of accessories, etc.
- Certification must be signed and scaled by Registered Land Surveyor in State of Montana.
   Fill in Cross Index & Section Diagram at bottom of sheet.

## CERTIFIED CORNER RECORDATION


Corner Cor of Secs. 15,16,21,22 T. 28N R. 29W P.M.M. Lincoln County


(Record) Set Quartz Stone 18x12x7 ins 12 ins. in ground with 3 notches on South and east edges.

Stone as described and undisturbed.

- (Record) Hemlock 8" diam. bears N  $6^{\circ}E$ , 64 lks. T28NR29W S15 BT (Found) Hemlock 14" diam bears N6°E 42.2' scribed T28NR29W S15 BT
- (Record) Fir 6" diam. bears S49°E 29 lks. T28NR29W S15 BT (Found) No evidence of
  - (Record) Fir 11" diam.bears S30W 17 1ks. T28NR29W S21 BT (Found) Fir 22" diam. bears \$30W 11.2' with scribe overgrown.
  - (Record) Tamarack bears N10°W 70 lks. T28NR29W S16 BT. (Found) No evidence of
    - $30"x2\frac{1}{2}"$  post with  $3\frac{1}{4}"$  Alum Cap in ground and burnied (set) stone alongside. marked new B.T.s as follows:

Fir 8" diam. bears S24°E 11.3' scribed T28NR29W S22BT. Fir 8" diam. bears N28°W 26.0' scribed T28NR29W S16BT.

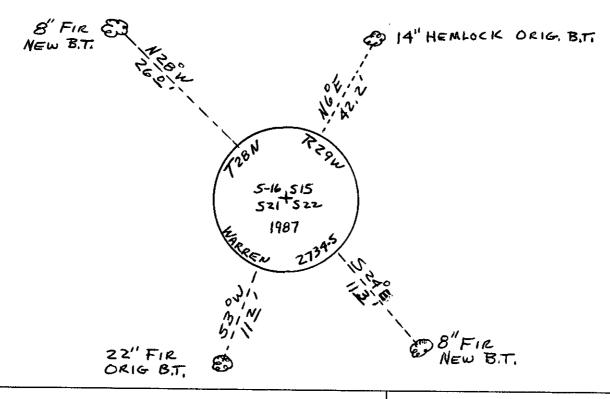

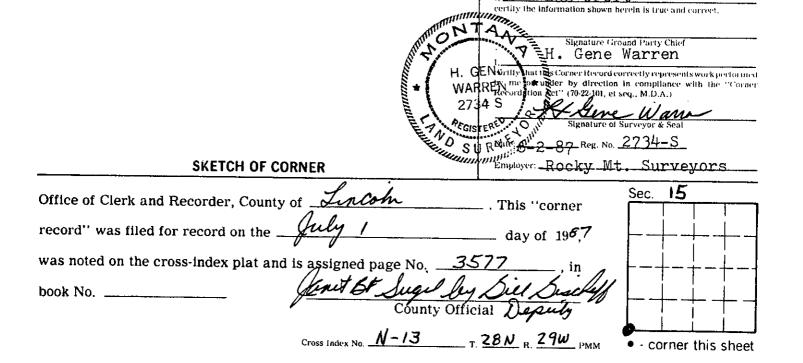

CERTIFICATION

Dan Croft