

INSTRUCTIONS

1. Original and/or subsequent record used to evaluate the corner position.
2. Description of evidence found, note discrepancies in the record, state method of establishing lost or obliterated corners.
3. Description of monument and accessories set to perpetuate the corner position.
4. Sketch of corner, show all pertinent data which can best be shown in a sketch example, corner marking, topography ties, position of accessories, etc.
5. Certification must be signed and sealed by Land Surveyor registered in the State of Montana.
6. Fill in Cross Index & Section Diagram at bottom of sheet.

CERTIFIED CORNER RECORDATION

Corner W1/4 Sec. 16 T. 29 N. R. 31 W. P.M.M. Lincoln County

- I. 1893 G.L.O. Original record by D. P. Mumbrue: Set a 3 ft. wood post as monument and scribed fir and larch bearing trees.

1963 B.L.M. Remonumentation record by G. F. Pittman et al: "The 1/4 sec. cor. of secs. 16 and 17, monumented with the decayed remains of a wooden post, firmly set in the ground, and witnessed by the original bearing trees.

At the corner point

Set an iron post, 30 ins. long, 2 1/2 ins. diam., 26 ins. in the ground, with brass cap mkd.

T29N R31W
1/4
S17 | S16
1963

from which

The the original bearing trees:

A fir, 19 ins. diam., bears S86° E, 23 lks. dist., mkd. with an overgrown blaze. (Record)

A larch, 16 ins. diam., bears N66 1/2° W, 44 lks. dist., mkd. with an overgrown blaze. (Record)


Bury the remains of the original wooden post alongside and raise a mound of stone, 2 ft. diam., around the iron post."

- II. Found an iron pipe, 2 1/2 ins. diam., 6 ins. above ground, with a 3 1/4 ins. diam., B.L.M. brass cap marked as shown above, from which:

A fir, 20 ins. diam., bears S87° E, 15.2 ft. dist., scribing overgrown.

A larch, 16 ins. diam., bears N66° W, 29.3 ft. dist., scribing overgrown.

- III. Attached Land Survey Monument and Bearing Tree signs on bearing trees. Set a 6 ft. galvanized steel guard post with Land Survey Marker and Property Boundary decals, North, 3 ft. This corner lies in an old burned area, where new growth is about 6 ft. high and 2-3 ins. diameter. Therefore, no new accessories are established. Magnetic Declination: 21° East

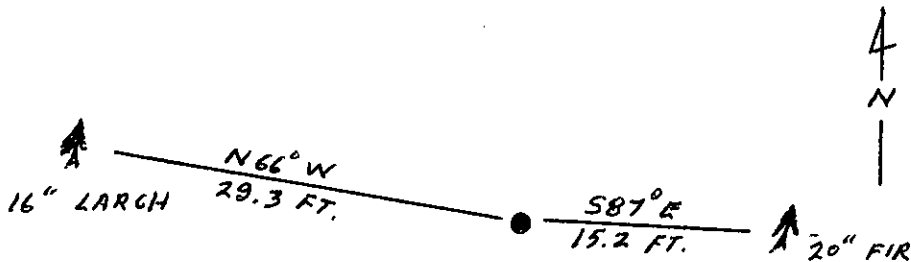

SKETCH OF CORNER

CERTIFICATION

I, Jane Eby
certify the information shown herein is true and correct.

Signature Ground Party Chief

I, Alvah F. Hughes
certify that this Corner Record correctly represents work performed by me or under my direction in compliance with the "Corner Recordation Act" (70-22-101, et seq., M.C.A.)

Alvah F. Hughes
Signature of Surveyor & Seal

Date: 4/16/90 Reg. No. 7322-5

Employer: U.S. FOREST SERVICE


Office of Clerk and Recorder, County of Lincoln. This "corner record" was filed for record on Aug 10, 1990 was noted on the cross-index plat and is assigned page No. 4264, in book No. _____

Janet H. Auger by Brie Buehler
County Official

L-9

Cross Index No. _____ T. _____ R. _____ P.M.M.

Sec. 16

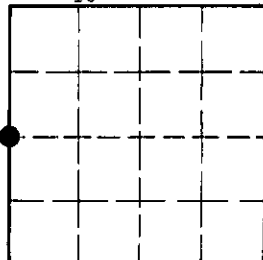

• - corner this sheet