CERTIFIED LAND CORNER RECORDATION

(REFERENCE FSM 7153.53)

DESCRIPTION OF CORNER EVIDENCE FOUND, AND ORIGINAL RECORD (IF KNOWN)

Found a larch stump in Section 9 with bearing tree markings visible. Section 8 bearing tree is a rotted log which had visible scribe. No evidence found of the original post. The Section 9 bearing tree bears S. $49-1/4^{\circ}E$., 12 links, and the Section 8 bearing tree bears N. $77^{\circ}W$., 20 links.

DESCRIPTION OF MONUMENT AND ACCESSORIES ESTABLISHED TO PERPETUATE THE ORIGINAL LOCATION OF THIS CORNER:

For the 1/4 corner common to Sections 8 and 9, T. 29 N., R. 31 W., P.M.M., I established the corner point by intersecting the recorded distances from the bearing tree. I set $^{\circ}$ a 2-1/2"x30" aluminum post with an aluminum cap marked as shown at the right.

The new bearing trees I established were:

A 10" douglas fir, S. 84°30' E., 23.2 feet
Section 9 Bearing Tree
A 15" cedar bears N. 63°45' W., 29.6 feet
Section 8 bearing tree

Date of work: May 26, 1976.....

1 1/4 cor. = 1976

1976

noted on the cross-index plat and is

Cross Index No. G - 9 T. 29 N., R. 31 W., P. Mer.

SKETCH, WITH COURSE AND DISTANCE TO ADJACENT CORNERS IF DETERMINED IN THIS SURVEY.


(MAY SKETCH OR PASTE REPRODUCTION ON REVERSE SIDE.)

(Record from original G.L.O. fieldnotes)

Office of Clerk and Recorder, County of

This "corner record" was filed for record on the

assigned page No. 488 , in book No.

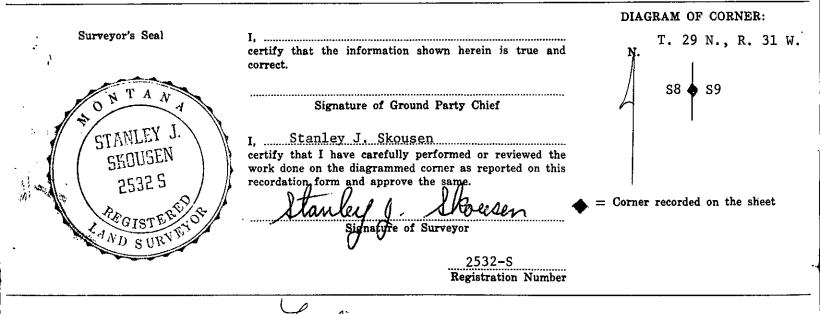

}

By Mar Wi STATE OF MONTANA COUNTY OF LINCOLD pund Filed tyle

****** •