
CERTIFIED CORNER RECORDATION

Corner	Sec. Cor.	Sec.	17,18	T.	30N	R.	27W	P.M., MT	Lincoln	County
			19&20							•

I. <u>1893 G.L.O. Original Record by James S. Keerl et. al.:</u> Set a granite stone, 15x8x7 ins., 10 ins. in the ground, for cor. to secs. 17,18,19&20, mkd. with 3 notches on S. and 5 notches on the E. edges, and raised a mound of stone, 1 1/2 ft. high, 2 ft. base alongside. Scarce timber, no bearing trees set.

1982 B.L.M. Remonumentation Record by Cruz D. Almanza: Found granite stone 15x8x7ins., firmly set 10 ins. in the ground, mkd. as described in the original record. At the corner point, set an aluminum post, 30 ins. long, 2 1/2 ins. diam., 22 ins. in the ground, with aluminum cap mkd. as shown:

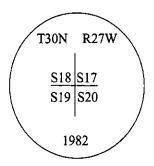

Established four bearing trees:

A larch, 12 ins. diam., bears N6°E, 106 lks. dist., mkd. "T30N R27W S17 BT".

A pine, 8 ins. diam., bears S51°E, 11 lks. dist., mkd. "T30N R27W S20 BT".

A larch, 14 ins. diam., bears S74 1/2°W, 94 lks. dist., mkd. "T30N R27W S19 BT".

A larch, 14 ins. diam., bears N78 3/4°W, 34 lks. dist., mkd. "T30N R27W S18 BT".

Bury the original stone alongside and raise a collar of stone, 3 ft. diam., around the aluminum post.

II. Found a 2 1/2 in. diam. iron pipe, protruding 8 in. above the ground, firmly set, with a 3 1/4 in. diam. brass cap mkd. as shown above.

from which:

A larch, 15 ins. diam., bears N6°E, 109.6 ft. (106 lks.) dist., mkd. with a healed face.

A down pine, 9 ins. diam., bears S51°E, 7.3 ft. (11 lks.) dist., no visible scribe.


A larch, 17 ins. diam., bears N73°W (rec. N78 3/4°W), 22.4 ft. dist., mkd. with a healed face.

III. Established one new bearing tree:

A pine, 10 ins. diam., bears West, 1.4 ft. dist., mkd. "T30N R27W S20 BT". No bearing trees available in section 19.

Painted bearing trees and attached Land Survey Monument and Bearing Tree signs.

Magnetic Declination: 20° East.

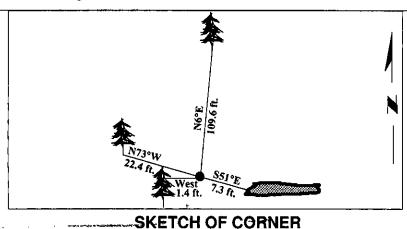

certify the information shown items is true and correct.

Rex O. Rice

certify the information shown items is true and correct.

I. Ronald A. Pearson

certify that this Corner Report correctly represents work performed by me or under my direction in compliance with the "Corner Reconstition Act" (70-22-101, et seq., M.C.A.)

Signature of Surveyor & Seai

Date: 12/30/96

Reg. No.: 9008LS

Employer: U.S. FOREST SERVICE

Sec. 2	20	
	<u> </u>	
	<u></u>	

oss Index No.

^{T.} 30N

27W P.M., MT