CERTIFIED CORNER RECORDATION
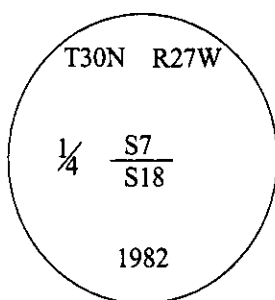
Corner	1/4	Sec.	7 & 18	T.	30N	R.	27W	P.M., MT	Lincoln	County

I.   <u>1893 G.L.O. Original Record by James S. Keerl et. al.:</u> Set a granite stone, 14x12x10 ins., 10 ins. in the ground, for 1/4 sec. cor. of secs. 7 & 12, mkd. "1/4" on the N. face.

from which:

        A pine, 3 ins. diam., bears N39°E, 20 lks. dist., mkd. "1/4 S BT".
        A pine, 3 ins. diam., bears S14°W, 15 lks. dist., mkd. "1/4 S BT".

<u>1982 B.L.M. Remonumentation Record by Cruz D. Almanza:</u> Found granite stone, 14x12x10 ins., firmly set, 10 ins. in the ground, mkd. "1/4" on the N. face and witnessed by the remains of one original bearing tree. At the corner point, set an aluminum post, 30 ins. long, 2 1/2 ins. diam., 22 ins. in the ground, with the aluminum cap mkd. as shown:

```
        T30N   R27W

              S7
        ¼    ————
              S18

              1982
```

Established two new bearing trees, buried the original stone alongside and raised a collar of stone, 3 ft. diam., around the aluminum post.
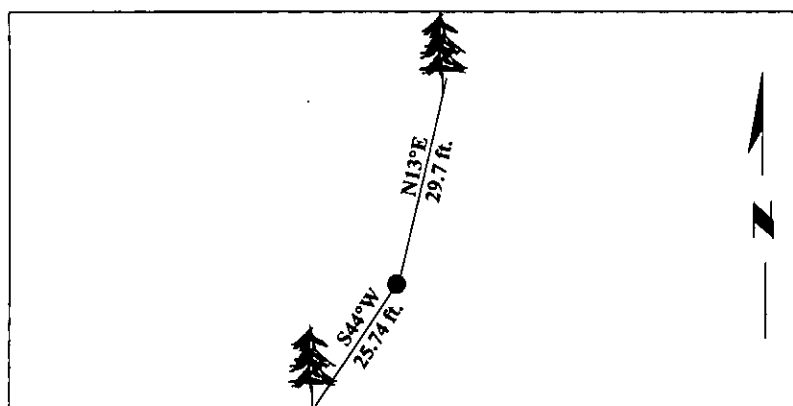
II.   Found a 2 1/2 in. diam. aluminum pipe, protruding 9 ins. above the ground, firmly set, with a 3 1/4 in. diam. aluminum cap mkd. as shown above.

from which:

        A larch, 18 ins. diam., bears N13°E, 29.7 ft. dist., mkd. with a healed face. (BLM-record)
        A larch, 16 ins. diam., bears S44°W, 25.74 ft. dist., mkd. with a healed face. (BLM-record)
        Found no evidence of GLO bearing trees.

III.   Painted bearing trees and attached Land Survey Monument and Bearing Tree signs.

Magnetic Declination: 20° East.

SKETCH OF CORNER

CERTIFICATION

I, **Mark Federman** certify the information shown herein is true and correct.

I, **Ronald A. Pearson** certify that this Corner Record correctly represents work performed by me or under my direction in compliance with the "Corner Recordation Act" (70-22-101, et seq., M.C.A.)
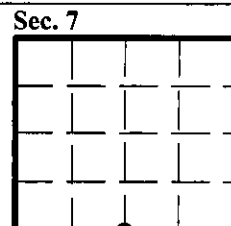
Signature of Surveyor & Seal

Date: **12/30/96**

Reg. No.: **9008LS**

Employer: **U.S. FOREST SERVICE**