## -CERTIFIED CORNER RECORDATION


30N 29W P.M., MT Lincoln County 18&19 Corner 1/4 Secs.

1903 G.L.O. Record by George A. Fessenden et.al.: Set a slate stone, 14x7x6 ins., 9 ins. in the ground I. for 1/4 sec. cor., mkd. "1/4" on N. face.

Established two bearing trees:

A fir, 6 ins. diam., bears N08 1/4°E, 42 lks. dist., mkd. "1/4 S18 BT". A fir, 6 ins. diam., bears S32°W, 110 lks. dist., mkd. "1/4 S19 BT".

1974 Certified Corner Recordation by John C. Erickson, 3979S: Found no evidence of the original stone, or the bearing trees. Reset corner by using single proportion method. At the corner position, set a Corps of Engineers brass cap, mkd. as shown.

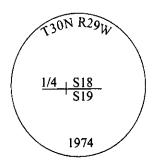

Established two new bearing trees, brass cap is 0.2 ft. downhill from large boulder, 2.0x3.0x1.0 ft. in diam.

П. Found a 1.0 in. diam. iron pipe, firmly set, protruding 4 ins. above ground, with a 3 1/2 in. diam., C.O.E brass cap, mkd. as shown. Found the reference boulder, 2x3x1 ft. diam., South, 0.2 ft. dist. of the corner.

from which:

No.

A fir, 12 ins. diam., bears \$40°W, 16.5 ft. dist., with visible scribe. (COE-record) A fir, 10 ins. diam., bears N49°W, 24.4 ft. dist., with visible scribe. (COE-record-N39°W,-34 lks.-22.44 ft.)

III. Painted bearing trees and attached Land Survey Monument and Bearing Tree signs.

Magnetic Declination: 20° East

