

## INSTRUCTIONS

Original and/or subsequent record used to evaluate the corner position.

Description of evidence found, note discrepancies in the record, state method of establishing lost or obliterated corners.

Description of monument and accessories set to perpetuate the corner position.

Sketch corner, show all pertinent data which can best be shown in a sketch example, corner marking, topography etc., position of accessories, etc.

Certification must be signed and sealed by Registered Land Surveyor in State of Montana.

Fill in Cross Index &amp; Section Diagram at bottom of sheet.

## CERTIFIED CORNER RECORDATION

Corner 1/4 28  
33T. 30N R. 31W P.M.M.LINCOLN

County

Date of Work: October 15, 1982

- I. 1973, BLM Record, Found  $2\frac{1}{2}$  ins. diam. Iron post, firmly set, 6ins. above ground, in a collar of Stone with Brass cap MKD: T30N. R31W.

 $\frac{1}{4}$  S.28  
S.33  
1962

From which:

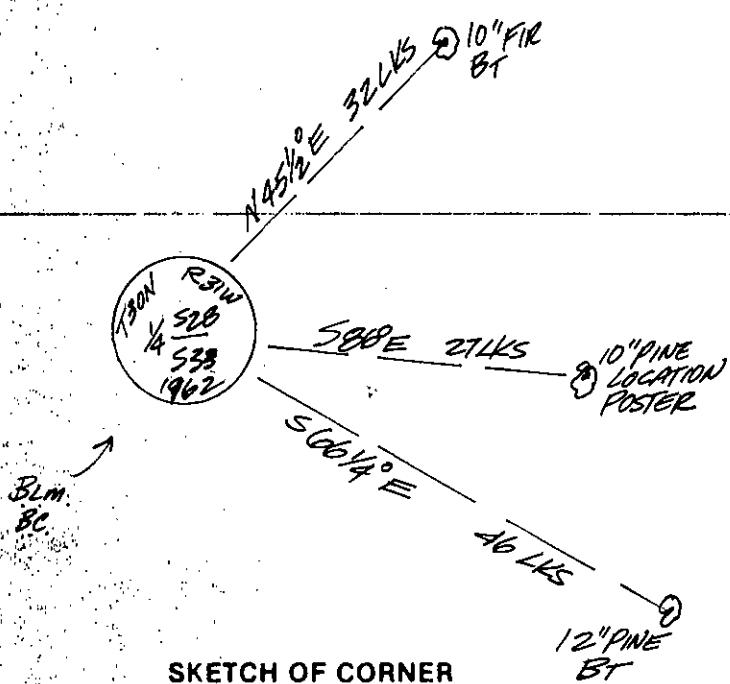
1. A decayed stump 15 ins. diam., bears N.  $73\frac{1}{4}^{\circ}$  E., 34.98 LKS dist., MKD:  $\frac{1}{4}$ S.BT.
2. A decayed stump 15 ins. diam., bears S.  $77^{\circ}$  W., 25.08 LKS dist., No visible marks.
3. A Fir 9 ins. diam., bears N.  $45\frac{1}{2}^{\circ}$  E., 32 LKS dist., MKD:  $\frac{1}{2}$  S.28BT (Record N. 32 E.)
4. A Pine 10 ins. diam., bears S.  $66\frac{1}{4}^{\circ}$  E., 46 LKS dist., MKD  $\frac{1}{4}$  S. 33 BT. (Record, S.  $75^{\circ}$  E.)

- II. 1982 Found  $2\frac{1}{2}$  ins. diam. Iron post with Brass cap. Per BLM Record.

1. Found stump rotted to ground level.
2. Stump rotted to ground level.
3. A 10 ins. Fir bears (N.  $45\frac{1}{2}^{\circ}$  E. 32 LKS ART 5/62.)
4. A 12 ins. Pine bears (S.  $66\frac{1}{4}^{\circ}$  E., 46 LKS ART 5/62.)

Location poster on 10 ins. L.P.Pine ( $\frac{1}{4}$ corner 5/16/62, dist. 27 LKS bearing S. $86^{\circ}$  E., ART.)

- III. I painted RED bands around bearing trees, hung an attention sign on tree with ART location poster, and I painted corner monument and rock mound.

Office of Clerk and Recorder, County of LINCOLN

This "corner record"

Sec: 33

was filed for record on the 17<sup>th</sup> day of Nov. 1982, was noted on the cross-index plat and is assigned page No. 2066, in book No. Eleanor L. Vaughn by Betty L. Concess  
County Official deputy

Reg. No. 42325-S-NDate: 10-15-82Employer: KOOTENAI ENGINEERING INC.Reg. No. 42325-S-NDate: 10-15-82

