

INSTRUCTIONS

1. Original and/or subsequent record used to evaluate the corner position.
2. Description of evidence found, note discrepancies in the record, state method of establishing lost or obliterated corners.
3. Description of monument and accessories set to perpetuate the corner position.
4. Sketch of corner, show all pertinent data which can best be shown in a sketch example, corner marking, topography ties, position of accessories, etc.
5. Certification must be signed and sealed by Land Surveyor registered in the State of Montana.
6. Fill in Cross Index & Section Diagram at bottom of sheet.

CERTIFIED CORNER RECORDATION

Corner $\frac{1}{4}$ Cor. Sec. 28 & 33 T. 31N R. 30W P.M.M. Lincoln County

Original GLO Notes: Set a slate stone 16x8x6 in. set 11" in ground for $\frac{1}{4}$ Sec.

Cor. marked $\frac{1}{4}$ on the N. face, from which:

A fir 12" bears N34°40'W 33 lks., mkd. $\frac{1}{4}$ S28 BT.

A tamarack 8" bears S26°35'W 15 lks., mkd. $\frac{1}{4}$ S33 BT.
(1898 by Paul S.A. Rickel)

Corner monumentation survey: $\frac{1}{4}$ cor. of Sec. 28 & 33 determined from one of the bearing trees(original). Set an iron post, 30" long, 2 $\frac{1}{2}$ " diam., 26" in the ground, w/ brass cap mkd:

T31N R30W
S28

$\frac{1}{4}$ ———
S33

1965

from which original bearing tree:

A fir 19" bears N34°40'W 33 lks., mkd. $\frac{1}{4}$ S28 BT.

The new bearing tree:

A pine 14" bears S17 $\frac{3}{4}$ °E 60 lks., mkd. $\frac{1}{4}$ S33 BT.

(1965 by Duane G. Lindenberg, Cadastral Surveyor)

Found a BLM 3 $\frac{1}{2}$ " brass cap on a 2" iron pipe mon. on a steep side hill slope to the NNW w/ an 8" log lying next to the mon.

Found bearing trees:

A 16" Pine bearing S17°E 39.2 feet, scribe partly visible.

A 23" Fir bearing N34°W 20.9 feet, no scribe(Orig.)
All BT's painted and signed as per USFS Specs. and a sign post set alongside. Built a rock cairn 3' in diam. around mon. and cleared 6' in diam.

An old skid road falls 15' S. of Mon.


Mkd: T31N R30W

S28
 $\frac{1}{4}$ ———
S33
1965

Decl. 20°E
Assumed.

Cor. mkd.: T31N R30W

S28
 $\frac{1}{4}$ ———
S33
1965

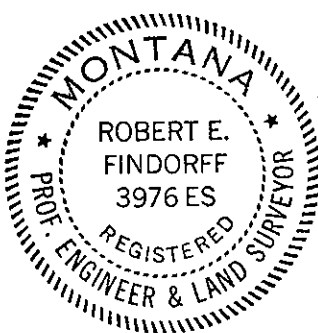

SKETCH OF CORNER (SEE ABOVE)

CERTIFICATION	
1. <u>Dennis D. Findorff</u>	certify the information shown herein is true and correct.
Signature Ground Party Chief	
1. <u>Robert E. Findorff</u>	certify that this Corner Record correctly represents work performed by me or under my direction in compliance with the "Corner Recordation Act" (7-6-20, et seq., M.C.A.)
Signature of Surveyor & Seal	
Date: <u>11/11/87</u>	Reg. No. <u>3976ES</u>
Employer: <u>Self</u>	

Office of Clerk and Recorder, County of Lincoln. This "corner record" was filed for record on Nov 16, 1987

was noted on the cross-index plat and is assigned page No. 3702, in


book No. _____

Grant B. Sigel by Bill Sigel
County Official Dupuy

Cross Index No. V-11 T. 31N R. 30W PMM

Adopted July 1, 1981, Montana Board of Professional Engineers & Land Surveyors

Sec. 33, T31N, R30W

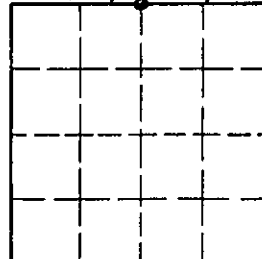

• corner this sheet