

INSTRUCTIONS

1. Original and/or subsequent record used to evaluate the corner position.
2. Description of evidence found, note discrepancies in the record, state method of establishing lost or obliterated corners.
3. Description of monument and accessories set to perpetuate the corner position.
4. Sketch of corner, show all pertinent data which can best be shown in a sketch example, corner marking, topography ties, position of accessories, etc.
5. Certification must be signed and sealed by Land Surveyor registered in the State of Montana.
6. Fill in Cross Index & Section Diagram at bottom of sheet.

CERTIFIED CORNER RECORDATION

Corner S $\frac{1}{4}$ Cor. Sec. 33 T. 31N R. 30W P.M.M. Lincoln County

Original GLO Notes: Set a slate stone 14x8x6 in. 9" in the ground for $\frac{1}{4}$ Sec.

Cor. marked $\frac{1}{4}$ on the North face from which:

A tamarack 30" bears North 10 lks., mkd. $\frac{1}{4}$ S33 BT.

A fir 24" bears S4 15° E 84 lks., mkd. $\frac{1}{4}$ S4 BT.

(1898 by Paul S.A. Rickel)

Corner monumentation survey: The $\frac{1}{4}$ sec. cor. of Sec. 4 & 33, on S. boundary of the Twp., determined from the remains of the original bearing trees. At the corner point- Set an iron post 30" long, 2 $\frac{1}{2}$ " diam., 26" in the ground w/ a brass cap mkd:

T31N R30W

from which the original bearing trees:

A fir 26" bears S4 4° E 84 lks., mkd. $\frac{1}{4}$ S4 BT.

A stump hole bears N45 $^{\circ}$ W 10 lks., w/ fallen log mkd. $\frac{1}{4}$ S33 BT.

$\frac{1}{4}$ S4

T30N

1965

The new bearing tree:

A fir 8" bears N45 $^{\circ}$ W 29 lks., mkd. $\frac{1}{4}$ S33 BT.

(1965 by Duane G. Lindenberg, Cadastral Surveyor)

Found a BLM 3 $\frac{1}{2}$ " brass cap on a 2" iron pipe monument on a steep sidehill to the NW near coulee bottom 30' dist., more or less.

Existing Bearing trees:

A fir 29" bears S4 $^{\circ}$ E 55.4 feet, scribe overgrown. (original)

A 12" fir bears N45 $^{\circ}$ W 19.3 feet, scribe not visible.

Mkd:

T31N R30W

S33

$\frac{1}{4}$

S4

T30N

1965

New Bearing tree: A 9" fir bears S76 $^{\circ}$ E 12.0 feet, mkd. $\frac{1}{4}$ S4 BT.

All BT's painted and signed as per USFS specs. A rock cairn 3' diam. built around mon. and ground cleared to 6' diam. A sign post set near corner.

Decl. 20 $^{\circ}$ E

Assumed.

Cor. Mkd.: T31N R30W


S33

$\frac{1}{4}$

S4

T30N

1965

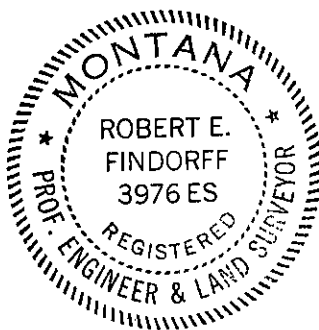

CERTIFICATION

1. ~~Dennis D. Findorff~~

certify the information shown herein is true and correct.

Signature Ground Party Chief

1. Robert E. Findorff

certify that this Corner Record correctly represents work performed by me or under my direction in compliance with the Corner Recordation Act, 1962, M.C.A.

Signature of Surveyor & Seal

Date: 11/11/87 Reg. No. 3976 ES

Employer: Self

SKETCH OF CORNER (SEE ABOVE)

Office of Clerk and Recorder, County of Lincoln This "corner


record" was filed for record on Nov 16, 1987

was noted on the cross-index plat and is assigned page No. 3704 in

book No. _____

County Official

Sec. 33, T31N, R30W

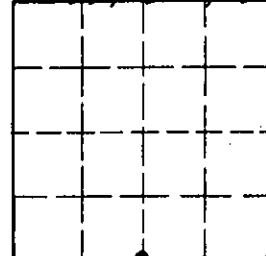

• - corner this sheet

Cross Index No. Z-11 T. 31N R. 30W P.M.M.

Adopted July 1, 1981, Montana Board of Professional Engineers & Land Surveyors