

INSTRUCTIONS

1. Original and/or sub record used to evaluate the corner position.
2. Description of evidence found, note discrepancies in the record, state method of establishing lost or obliterated corners.
3. Description of monument and area set to perpetuate the corner position.
4. Sketch of corner, show all pertinent data which can best be shown in a sketch example, corner marking, topography ties, position of access, etc.
5. Certification must be signed and sealed by Land Surveyor registered in the State of Montana.
6. Fill in Cross Index & Section Diagram at bottom of sheet.

CERTIFIED CORNER RECORDATION

Corner $\frac{1}{4}$ Cor. Sec. 33 & 34 T. 31N R. 30W P.M.M. Lincoln County

Original GLO field notes: Set a slate stone 16x12x5 in., 11 in. in the ground, for $\frac{1}{4}$ Sec. Cor. marked $\frac{1}{4}$ on W. face from which:

A tamarack 18" bears East 17 lks., marked $\frac{1}{4}$ S34 BT.

A tamarack 16" bears S81°11'W 16 lks., marked $\frac{1}{4}$ S33 BT.
(1898 GLO survey by Paul S.A. Bickel)

Remonumentation Survey Filed Notes: The $\frac{1}{4}$ sec. cor. of Sec. 33 & 34, monumented with a limestone, 16x12x5 in., firmly set, marked on the W. side and witnessed by the remains of the original bearing trees:

At the corner point- Set an iron post, 30" long, 2 $\frac{1}{2}$ " dia., 26" in the ground, with brass cap marked:

T31N R30W

$\frac{1}{4}$
S33 | S34

1965

from which- the original bearing trees:

A snag, 14" bears EAST 17 lks., mkd. $\frac{1}{4}$ S34 BT.

A snag, 14" bears S81°11'W 16 lks., mkd. with an overgrown blaze.
(record)

The new bearing trees:

A fir, 20" bears S59°E 34 lks., mkd. $\frac{1}{4}$ S34 BT.

A fir, 5" bears S37°W 21 lks., mkd. $\frac{1}{4}$ S33 BT. 1965

Bury original stone alongside iron post. (By: Duane G. Lindenberg
Cadastral Surveyor)

Found 3 $\frac{1}{2}$ " brass cap on 2" iron pipe monument on a sidehill falling to North.

Existing Bearing Trees:

Bears

A snag 14" laying on ground, East 11.2 ft., scribe visible. (Original)

A 24" fir bears S58°E 23.5 ft., scribe visible. (Remon. Survey)

A 8" fir bears S38°W 14.3 ft., scribe overgrown. (Remon. Survey)

A snag 14" bears S81°W 10.9 ft., scribe visible. (Original)

Set steel sign post near corner, built 3' diam. rock cairn around cor. mon. and cleared ground to 6' dia. All BT's signed and painted to meet USFS Specs. Sign post South of Cor.

Decl. assumed
20°E.

Cor. Mkd. T31N R30W

$\frac{1}{4}$

S33 | S34

1965

BLM

CERTIFICATION

~~XXXXXXXXXXXX~~

certify the information shown herein is true and correct.

Signature Ground Party Chief

Robert E. Findorff

I, Robert E. Findorff, certify that this Corner Record correctly represents corner monumented by me or under my direction in compliance with the Corner Recordation Act (70-22-101, et seq., M.C.A.)

1/9/88 Signature of Surveyor Seal

Date ~~1/9/88~~ Reg. No. 3976ES

Employer: Self

SKETCH OF CORNER (SEE ABOVE)


Office of Clerk and Recorder, County of Lincoln. This "corner record" was filed for record on Jan 28, 1988

was noted on the cross-index plat and is assigned page No. 3800, in

book No. _____

Janet B. Sugil by Bill Bickel
County Official Dip.

Sec. 33, T31N, R30W

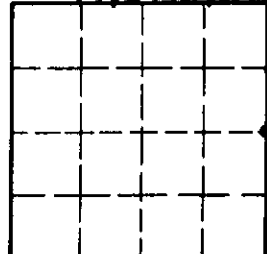

• - corner this sheet

Cross Index No. X-13 T. 31N R. 30W P.M.M.

Adopted July 1, 1981, Montana Board of Professional Engineers & Land Surveyors