## INSTRUCTIONS

- 1. Original and/or subset ent record used to evaluate the corner position
- 2. Description of evidence found, note discrepancies in the record, state method of establishing lost or obliterated corners.
- Description of monument and accessories set to perpetuate the corner position.
   Sketch of corner, show all pertinent data which can best be shown in a sketch example, corner marking, topography ties, position of accessories, etc.
- 5. Certification must be signed and sealed by Land Surveyor registered in the State of Montana.
  6. Fill in Cross Index & Section Diagram at bottom of sheet.


## CERTIFIED CORNER RECORDATION

Corner 1/4 of Secs. 13 and 14 31 N., R. 31 W., P.M.M. Lincoln County

1901 G.L.O. original record by Abram L. Jaqueth: Set a stone with two bearing trees.

1963 BLM remonumentation by Gerald F. Pittman et al: "The 1/4 sec. cor. of secs. 13 and 14, monumented with a argillite stone, 14x10x6 ins., firmly set and mkd. 1/4 on the W. face, and witnessed by the original bearing trees.

At the corner point, set an iron post, 30 ins. long, 2 1/2 ins. diam., 26 ins. in the ground. with brass cap mkd.



from which, the original bearing trees:

A pine, 29 ins. diam.. bears \$26 1/4°E, 90 lks. dist., visible marks \$1. (Record: N81 1/2°E, 69 lks.)

A pine, 22 ins. diam., bears N25  $1/2^{\circ}$ W, 114 1ks. dist., mkd. 1/4 S14 BT. (Record: S18  $1/4^{\circ}$ W, 33 1ks.)


Bury the original stone alongside of the iron post."

II. Found a 2 1/2 ins. diam. pipe, 4 ins. out of the ground, with BLM brass cap mkd. as shown, set stone 14x11x6 ins.. mkd. 1/4 next to iron pipe, from which

> A ponderosa pine, 30 ins. diam., bears  $824^{\circ}E$ , 61.0 ft. (92 lks.) dist., visible scribing. (Record: tamarack, N81 30'E, 69 lks.) A ponderosa pine, 24 ins. diam., bears N23 W. 81.9 ft. (124 lks.) dist., visible scribing. (G.L.O. record: tamarack, S18 1/4 W, 33 lks.) (B.L.M. record: N25 1/2 W, 114 lks.)

III. Painted red bands around the bearing trees and attached Land Survey Monument and Bearing Tree signs. Set a 6 ft. galvanized steel guard post with Land Survey Marker and Property Boundary decals, south, 3 ft.

Magnetic Declination: 20 East

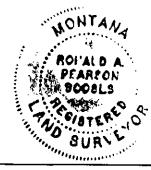

" PINE SKETCH OF CORNER

T	
	CERTIFICATION
I, _	Kevin A. Todd
cer	tily the information shown herein is true and correct.
	Mein of Tool
	Signature Ground Party Chief
1	Ronald A. Pearson
	tify that this Corner Record correctly represents work performed
	me or under my direction in compliance with the "Corner condition Act" (70-22-101, et seq., M.S.A.)
—	Size of State of Stat
!	Signature of Surveyor & Seal
Da	te: 8/5/91 Reg. No. 9008 LS
En	nolover: U.S. FOREST SERVICE

Sec. Office of Clerk and Recorder, County of aug 13, 1991 record" was filed for record on. was noted on the cross-index plat and is assigned page No. County Official book No. \_

> Cross Index No. L-21 T. 31 N R. 31 W PMM