
CERTIFIED CORNER RECORDATION

Corner 1/4 Sec. 33 & 34 T. 31N R. 31W P.M., MT Lincoln County

I. <u>1893 G.L.O. Original Record by Daniel P. Mumbrue et. al.</u>: Set a wooden post, 3 ft. long, 3 ins. square, 24 ins. in the ground, for 1/4 Sec. Cor., mkd. "1/4 S" on the W. face. Established two bearing trees.

1964 B.L.M. Remonumentation Record by Gerald F. Pitman et. al.: The 1/4 sec. cor. of secs. 33 & 34, monumented with a disintegrated wooden post, firmly set in the ground, and witnessed by the remains of the original bearing trees. At the corner point, set an iron post, 30 ins. long, 2 1/2 ins. diam., 27 ins. in the ground, with the brass cap mkd. as shown:

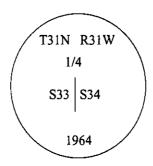

Established two new bearing trees:

A pine, 10 ins. diam., bears S80°E, 60 lks. dist., mkd. "1/4 S34 BT". A pine, 10 ins. diam., bears N69°W, 64 lks. dist., mkd. "1/4 S33 BT".

Bury the remains of the original wooden post alongside of the iron post.

II Found a 3 1/4 in. diam. B.L.M. brass cap, firmly set, flush with the ground, mkd. as shown above. from which:

A pine, 20 ins. diam., bears S80°E, 39.6 ft. (60 lks.) dist., mkd. with a healed face.


III Established one new bearing tree:


A pine, 11 ins. diam., bears \$30°W, 63.1 ft. dist., mkd. "1/4 \$33 BT".

Set a 6 ft. steel guard post, South, 4.0 ft., with Land Survey Monument and Property Boundary decals.

Painted bearing trees and attached Land Survey Monument and Bearing Tree signs.

Magnetic Declination: 20° East.

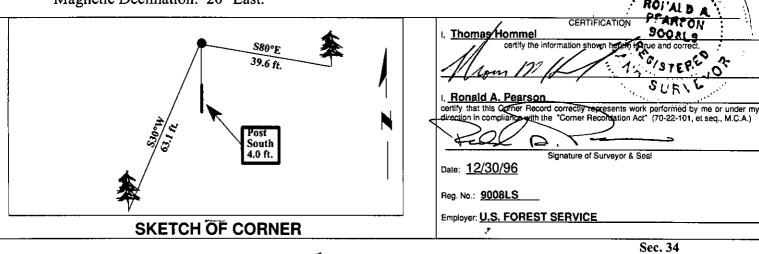

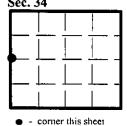

ss Index No. X_12 T. 3