
CERTIFIED CORNER RECORDATION

Corner N 1/16 Sec. 22&23 T. 30N R. 31W P.M., MT Lincoln Cou	ounty

I. 1972 B.L.M. survey by Hjellam and Pritchard: Set a 2 1/2 in. diam. iron post, marked two bearing trees.

1986 Corner Recordation by Harold W. Gruzing #2925-S: Found a 2 1/2 in. diam. iron post, projecting 4 ins. above ground, with brass cap mkd. as shown.

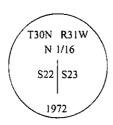

from which:

A pine, 7 ins. diam., bears N57°E, 13.4 ft. dist., mkd. "N 1/16 S23 BT". (record- 13.8 ft.) A pine, 8 ins. diam., bears S41 1/2°W, 17.9 ft. dist., mkd. "N 1/16 S22 BT". (record- 17.8 ft.)

Set a steel post with "Land Survey Monument" decal, 6 ins. W. of monument.

II. Found a 2 1/2 in. diam. iron pipe, 2 ins. above ground, firmly set, with a 3 1/4 in. brass cap mkd. as shown above, from which:

A pine, 5 ins. diam., bears N60°E, 13.4 ft. dist., mkd. "N 1/16 S23 BT". (rec. N57°E, 13.8 ft.) A fallen pine, 8 ins. diam., bears S28°W, 17.9 ft. dist., mkd. "N 1/16 S22 BT". (rec. S41 1/2°W, 17.8 ft.)


A steel guard post, with LSM and PB decals affixed, West, 0.2 feet.

III. Established one new bearing tree:

A fir, 15 ins. diam., bears \$21°E, 28.8 ft. dist., scribed "N 1/16 \$23 BT".

Painted red bands around the bearing trees and attached Land Survey Monument and Bearing Tree signs.

Magnetic Declination: 20° East

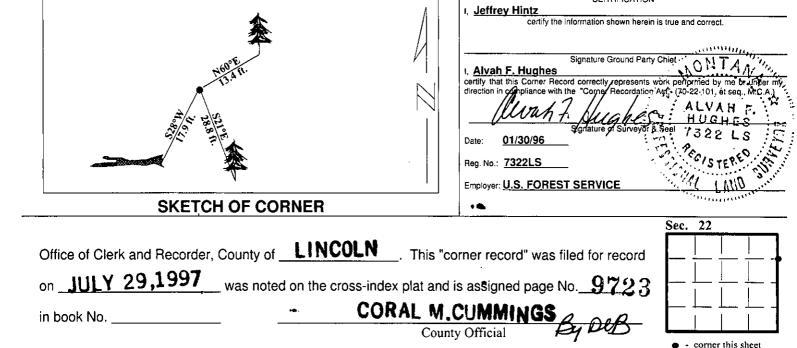

ross Index No. O-17

^{т.} 30N

31W PMM